

OFFICE OF THE PROPERTY APPRAISER

Summary Report

Generated On: 1/8/

Property Information	
Folio:	03-4117-034-0001
Property Address:	700 BILTMORE WAY Coral Gables, FL 33134-0000
Owner	REFERENCE ONLY
Mailing Address	
Primary Zone	5000 HOTELS & MOTELS - GENERAL
Primary Land Use	0000 REFERENCE FOLIO
Beds / Baths / Half	0/0/0
Floors	0
Living Units	ø (97
Actual Area	0 Sq.Ft
Living Area	0 Sq.Ft
Adjusted Area	0 Sq.Ft
Lot Size	0 Sq.Ft
Year Built	× 1963

Assessment Information	·		
Year	2015	2014	2013
Land Value	\$0	\$0	\$0
Building Value	\$0	\$0	\$0
XF Value	\$0	\$0	\$0
Market Value	\$0	\$0	\$0
Assessed Value	\$0	\$0	\$0

Benefits Information								
Benefit	Туре	2015	2014	2013				
Note: Not all benefits are applicable to all Taxable Values (i.e. County,								
School Board	I, City, Regional)							

Short Legal Description	
DAVID WILLIAM HOTEL CONDO	
CORAL GABLES BILTMORE SEC	
PB 20-28	
LOTS 6 THRU 22 INC BLK 10	



	2015	2014	2
The second second second	2015	2014	
County			
Exemption Value	\$0	\$0	
Taxable Value	\$0	\$0	
School Board	S = 5		
Exemption Value	\$0	\$0	
Taxable Value	\$0	\$0	
City	- 10 Miles	270	- Eli - Const
Exemption Value	\$0	\$0	
Taxable Value	\$0	\$0	
Regional			
Exemption Value	\$0	\$0	
Taxable Value	so	\$0	

Sales Information	on		
Previous Sale	Price	OR Book-Page	Qualification Description

The Office of the Property Appraiser is continually editing and updating the tax roll. This website may not reflect the most current information on record. The Property Appra and Miami-Dade County assumes no liability, see full disclaimer and User Agreement at http://www.miamidade.gov/info/disclaimer.asp

Version

CITY'S


EXHIBIT \

Print Results

đ


Address

700 BILTMORE WAY

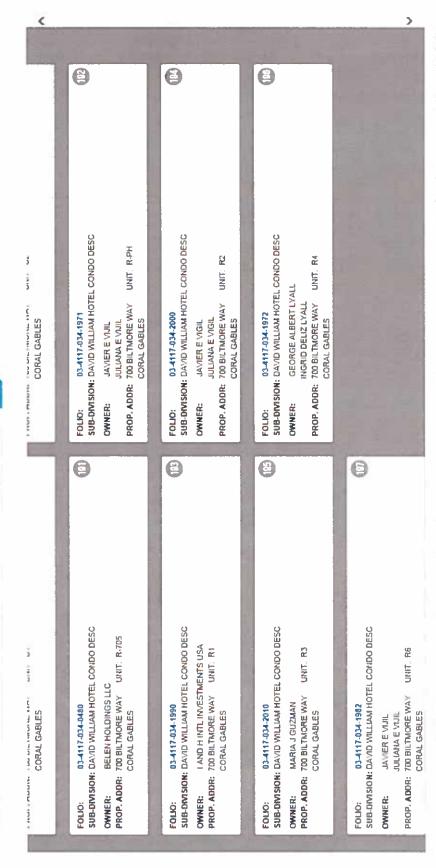

The Office of the Property Appraiser is continually editing and updating the tax roll. This website may not reflect the most current information on record. The Property Appraiser and Mismi-Dade County assumes no liability, see full disclaimen and User Agreement at http://www.mismidade.gov/finfo/disclaimer.asp

For incuries and successions email us at http://www.mamdade.cov/PAPortal/ContactForm/ContactFormMain asox

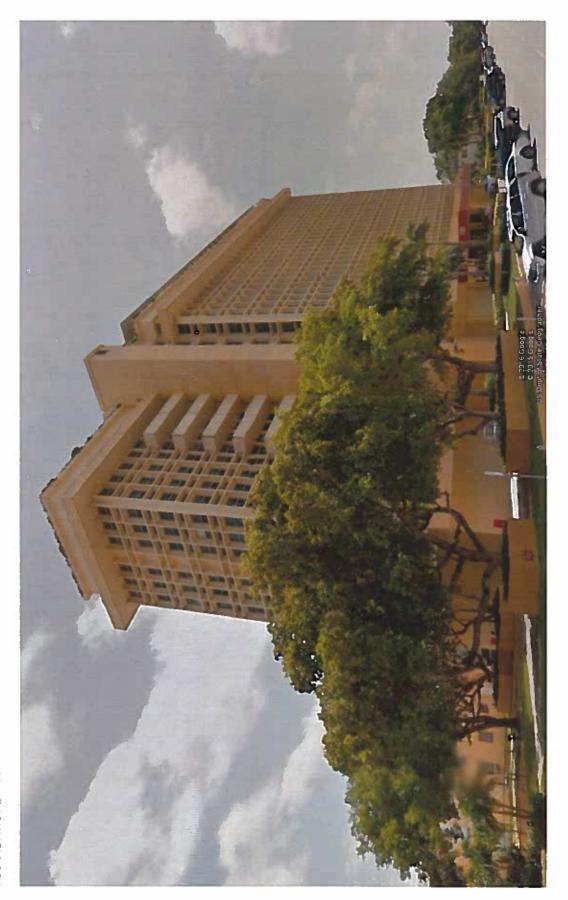

700 BILTMORE WAY



The City of Coral Gables

(1963) EXT GRANTED 8/1/13 Second little sent 9/11/13

Development Services Department CITY HALL 405 BILTMORE WAY CORAL GABLES, FLORIDA 33134

3/1/2013

2013

DAVID WILLIAMS HOTEL CONDO ASSOCIATION 700 BILTMORE WAY **CORAL GABLES, FL 33134-7528**

VIA CERTIFIED MAIL 40E4 44L4 5EPE EEL5 80L7 LP

RE: 700 BILTMORE WAY, CORAL GABLES, FL Folio # 03-42270034-0001 Recertification of Building 40 Years or older

Gentlemen:

This Department has been advised that the subject building is forty (40) years old, or older, having been built in 1963.

In accordance with the Miami-Dade County Code, Chapter 8, Section 8-11(f), a Florida Registered Architect or Professional Engineer must inspect said building and a report must be furnished to this Department with ninety (90) days from the date of this letter, indicating that the building meets the requirements of building recertification under the Code. In the event that repairs or modifications are found to be necessary resulting from the recertification inspection, the owner shall have a total of 150 days from the date of this Notice in which to complete indicted repairs or modifications.

The architect or engineer that you choose to do the inspection may obtain the required forms: "Minimum Procedural Inspection Guidelines for Building Recertification." from link: http://www.miamidade.gov/building/form-checklist.asp to access the interactive structural and electrical forms. In addition to the forms, a cover letter must state that that the property meets the requirement for building recertification; no additional documents or photographs are necessary.

The certification report, along with the filing fee in the amount of \$380.63; plus, \$2.45 per page document preservation fee must be paid with a check, or credit card payment to the "City of Coral Gables," and sent/delivered to:

> BUILDING RECERTIFICATION SECTION Coral Gables Building & Zoning Department 405 Biltmore Way Coral Gables, FL 33134

Any questions may be directed to (305) 460-5228. Thank you for your prompt consideration.

Sincerely,

Manuel Q. Lopez

Manuel Z. Lopez, P.E. **Building Official**

CITY'S



September 11, 2013

DAVID WILLIAM HOTEL CONDO ASSO 100
700 BILTMORE WAY
CORAL GABLES FL 33134-7555

VIA U.S. MAIL

Re: Building Recertification

Building Address: 700 BILTMORE WAY

Folio # 03-4117-034-0001

Dear Property Owner:

In a certified letter dated 3/1/2013, this Department notified you that the property referenced above, required building recertification pursuant to Miami-Dade County Code, Chapter 8, and Section 8-11(f). The letter informed that it was necessary to furnish this Department a report prepared by a licensed architect or engineer within 90-days, that said building meets the requirement of building recertification provided under the Minimum Inspection Procedural Guidelines for Building Recertification.


Please be advised that as of 9/11/2013, this building is deemed to be in NON-COMPLIANCE in that the report is overdue; which further may result in the revocation of the Certificate of Occupancy, as well as being subject to other penalties as provided in the Code.

Failure to contact us before 11/11/2013 may result in our forwarding this building to the Miami-Dade County Unsafe Structures Board for further determination.

Please govern yourself accordingly.

Sincerely,

Manuel Z. Lopez Manuel Z. Lopez, P.E. Building Official

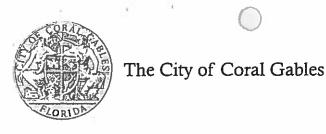

Development Services Department CITY HALL 405 BILTMORE WAY CORAL GABLES, FLORIDA 33134

November 18, 2013

DAVID WILLIAM HOTEL CONDO ASSO 700 BILTMORE WAY 100 Coral Gables, FL 33134-7563

<u>VIA CERTIFIED MAIL</u> 91 7108 2133 3932 6021 9781

91 7108 2133 3932 6021 9781

Re: Address: 700 BILTMORE WAY Folio # 03-4117-034-0001

Dear Property Owner/Manager:

This Department has received the Building Recertification report that you submitted for the building certification for the above-captioned property; however, the report indicates that remedial repairs* must be done to the building in order for it to meet minimum requirements stipulated for safe occupancy as prescribed in Miami-Dade County Code, Section 8-11.


Pursuant to the Code you must complete the repairs within sixty (60) days from the date the report was submitted to this Department; and then, you must contact the original architect/engineer, so that a follow-up letter indicates that the building is now recommended for recertification.

If you should have any questions regarding the specific repairs identified in the report, please contact the original architect/engineer that prepared the report. If you have further questions, please contact us at (305) 460-5228.

Manuel Z. Lopez

Manuel Z. Lopez, P.E. Building Official

^{*}Copy of the letter is attached

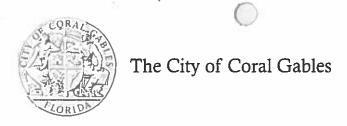

Development Services Department

June 2, 2015

CITY HALL 405 BILTMORE WAY CORAL GABLES, FLORIDA 33134

DAVID WILLIAMS HOTEL CONDO ASSOCIATION 700 BILTMORE WAY CORAL GABLES, FL 33134-7528 **FINAL NOTICE**

VIA CERTIFIED MAIL
91 7108 2133 3932 7095 9684

Re: Building Recertification 700 BILTMORE WAY Folio # 03-42270034-0001

Dear Property Owner:

In a certified letter dated 3/1/2013, this Department notified you the property referenced above requires a 40-year building recertification pursuant to Miami-Dade County Code, Chapter 8, Section 8-11(f). The letter informed you it was necessary to furnish this Department a report prepared by a licensed architect or engineer within 90-days specifying the building meets the requirements for building recertification provided under the Minimum Inspection Procedural Guidelines for Building Recertification.

Please be advised that as of 6/1/2015 the report will be overdue and this building will be deemed to be in NON-COMPLIANCE. This may result in the revocation of the Certificate of Occupancy, as well as, being subject to other penalties as provided in the Code.

Failure to contact us before 7/6/2015, will result in our forwarding this building information to the Miami-Dade County Unsafe Structures Board for further determination.

Please govern yourself accordingly.

Sincerely,

Manuel Z. Lopez, P.E.

Manuel Z. Lopez

Building Official

SENDER: COMPLETE THIS SECTION	COMPLETE	COMPLETE THIS SECTION ON DELIVERY	DELIVERY
 Complete Items 1, 2, and 3. Also complete item 4 if Restricted Delivery is desired. Print your name and address on the reverse 	A. Signature	Hag An	frail Daff
so that we can return the card to you. Attach this card to the back of the mailpiece, or on the front if space permits.	B. Received	B. Received by (Printed Name)	C. Date of Delivery
1. Article Addressed to:	D. Is delivery If YES, er	D. Is delivery address different from them 1? \(\text{T}\) Yes If YES, enter delivery address below: \(\text{T}\) No	m item 1?
DAVID WILLIAMS HOTEL CONDO ASSOCIATION			<i>,</i>
700 BILTMORE WAY	3. Service Type	pd/	
CORAL GABLES, FL 33134-7528	Certified Maile Registered Character Character	•	☐ Priority Mail Express™ Receipt for Merchandise Collect on Delivery
	4. Restricted	4. Restricted Delivery? (Extra Fee)	(e
2. Article Number (Transfer from service tabel) 91 7108 2	133	3432 7	7108 2133 3932 7095 9684
PS Form 3811, July 2013 Domestic Return Receipt	um Receipt		



The City of Coral Gables

Development Services Department CITY HALL 405 BILTMORE WAY CORAL GABLES, FLORIDA 33134

July 9, 2015

VIA CERTIFIED MAIL

91 7108 2133 3932 5924 9232

David Williams Hotel Condo Association 700 Biltmore Way Coral Gable, Fl. 33134

Re: 700 Biltmore Way

Folio # 03-4117-034-00001

Dear Property Owner/Manager:

This Department has received your request dated June 8, 2015 for an extension to provide us with the Recertification Report for the above referenced property.


By these means, I am granting you one hundred fifty (150) days from the date of this letter to provide the Recertification Report. If you have further questions please contact me at (305) 460-5242.

Sincerely,

Manuel G. Lopez

Manuel Z. Lopez, P.E. Building Official



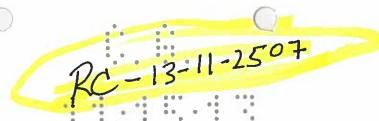

MIAMI-DADE COUNTY, FEORIDA BUILDING DEPARTMENT

Regulatory and Economic Resources
Department

MINIMUM INSPECTION PROCEDURAL GUIDELINES FOR BUILDING'S STRUCTURAL RECERTIFICATION

INSPECTION COMMENCED

DATE: February 25,2010

INSPECTION COMPLETED

DATE: February 26, 2010

INSPECTION MADE BY

Ingelmo Associates PA SIGNATURE:

PRINT NAME Paul Ingelmo, P.E.

TITLE: Engineer

ADDRESS: 250 Catalonia Avenue, Suite 301

Coral Gables, Florida 33134

a.	Name of Title:	The David Williams Hotel Condominium Association Inc						
b.	Street Address:	700 Biltmore Way, Suite 100, Coral Gables, Florida 33134 David Williams Hotel Condo Coral Gables Biltmore Sec PB 20-28						
C.	Legal Description:	Lots 6 thru 22 Inc Blk 10						
d.	Owners Name:	The David Williams Hotel Condominium Association Inc						
e.	Owner's Mailing Add	dress: 700 Biltmore Way, Suite 100, Coral Gables, Fl 33134						
f.	Folio Number of Bui	ilding: 03-4117-034-0001						
g.	Building Code Occu	pancy Classification: Residential Group-R2						
h.	Present Use: R	esidential, Condominium, Hotel.						
i.	General Description Additional Comme	i, Type of Construction, Size, Number of Stories, and Special Features nt: See below						

Told was

MINIMUM INSPECTION PROCEDURAL GUIDELINES FOR BUILDING'S STRUCTURAL RECERTIFICATION

1. DESCRIPTION OF STRUCTURE

a. Name of Title: The David William

The David Williams Hotel Condominium Association Inc

b. Street Address: 700 Biltmore Way, Suite 100, Coral Gables, Florida 33134

Legal Description: David Williams Hotel Condo Coral Gables Biltmore Sec PB 20-28 Lots 6

c. thru 22 Inc Blk 10.

d. Owners Name: The David Williams Hotel Condominium Association Inc.

e. Owner's Mailing Address: 700 Biltmore Way, Suite

700 Biltmore Way, Suite 100, Coral Gables, Florida 33134

f. Folio Number of Building: 03-4117-034-0001

g. Building Code Occupancy Classification: Residential Group-R2

h. Present Use: Residential, Condominium, Hotel.

i. General Description, Type of Construction, Size, Number of Stories, and Special Features The Building is 13 stories with a mechanical room and machine room above the penthouse level. The main building is a reinforced concrete frame that consists of a flat plate with a typical framing system at each floor except for the ground floor and the penthouse level. The basement and penthouse levels consist of a cast in place concrete beam, joist and slab framing. There is a basement level that has consistently been troubled by rising water; this basement level is used for parking and also contains various storage areas. The building exterior has some precast concrete non-structural features.

2. PRESENT CONDITION OF STRUCTURE

- a. General alignment (good, fair, poor, explain if significant)
 - 1. Bulging good
 - 2. Settlement good
 - 3. Deflections good
 - 4. Expansion good
 - 5. Contraction good
- b. Portion showing distress (Note, beams, columns, structural walls, floors, roofs, other)
 There are a number of concrete beams and slab areas on the ground floor framing system that are in a deteriorated state and will need to be repaired following standard concrete repair procedures. Wall areas along the exterior of the parking level also exhibit spalling that should be repaired as part of this effort. The exterior balconies exhibit a number of spalled and cracked areas that will require repair. The exterior concrete panels that serve as balcony railings and the parapet along the roof perimeter contain spalled and cracked areas that are a hazard if they would detach from the concrete sections. These shall also be repaired as part of the repair project. Some areas showing distress were found at the Penthouse level, specifically along the canopy slab located along the north side of the building and at the exterior wall along the cabanas. We also found sporadic spalling of the precast panels that serve as balcony railings.
- c. Surface conditions describe general conditions of finishes, noting cracking, spalling, peeling, signs of moisture penetration & stains.

Surface conditions were found to be in fair condition throughout the exterior. Stucco cracks were noted at some exterior masonry infill walls. Most of these can be sealed and addressed during a painting and waterproofing project. Masonry cracked areas were noted at the Penthouse and high roof areas of the mechanical room. See Figure 2.

dissemble; FINE if less than 1 mm i over 2 mm. Cracks were found as per the descri	
 e. General extent of deterioration – metals; rot or borer attack in wood. Some noted, limited to the areas ind 	- cracking or spalling of concrete or masonry; oxidation of icated.
	Some previous patching noted in various areas of the
· · · · · · · · · · · · · · · · · · ·	building.
g. Nature of present loading indicate; Equipment of present loading and storage	residential, commercial, other estimate magnitude. ge. Typical floor: residential. Roof level and penthouse:
residential.	ge. Typical floor, residential. Nool level and pentiflouse.
3. INSPECTIONS	
a. Date of notice of required inspection	on: Not Available
b. Date(s) of actual inspection Fe	bruary 25-26, 2010
c. Name and qualification of individua	al submitting inspection report:
Paul Ingelmo, P.E.	
	ther formal testing, if required, rather than manual or visual
procedures	
None required	Haa.
Structural repair note appropriate in the structural repair note appropriate in the structural repair note.	ille.
	ate acceptance): Existing deteriorated conditions noted
	ate acceptance). Exicting deteriorated conditions noted
above shall be repaired as a re	sult of this inspection. Structural remediation throughout
above shall be repaired as a re	sult of this inspection. Structural remediation throughout tecertification of the building is conveyed.
above shall be repaired as a re	
above shall be repaired as a re	
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a.	
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA	Recertification of the building is conveyed.
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a.	tecertification of the building is conveyed. sheet written data
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c.	ecertification of the building is conveyed. sheet written data photographs
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units	sheet written data photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units	sheet written data photographs drawings or sketches: Good condition N/A
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer 3. Paint only	sheet written data photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Fair condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer 3. Paint only 4. Other(describe) Precast co	sheet written data _ photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Good condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer 3. Paint only 4. Other(describe) Precast co h. Masonry finishes - interior	sheet written data photographs drawings or sketches: dicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Fair condition
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer 3. Paint only 4. Other(describe) Precast co h. Masonry finishes - interior 1. Vapor barrier	sheet written data photographs drawings or sketches: idicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Fair condition concrete elements-Fair condition except for noted spalls.
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer 3. Paint only 4. Other(describe) Precast of h. Masonry finishes - interior 1. Vapor barrier 2. Furring and plaster	sheet written data photographs drawings or sketches: idicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Fair condition concrete elements-Fair condition except for noted spalls.
above shall be repaired as a re the building is required before R 4. SUPPORTING DATA a. b. Enclosed c. 5. MASONRY BEARING WALL = In a. Concrete masonry units b. Clay tile or terra cota units c. Reinforced concrete tile columns d. Reinforced concrete tile beams e. Lintel or beams f. Other type bond beams g. Masonry finishes - exterior 1. Stucco 2. Veneer 3. Paint only 4. Other(describe) Precast co h. Masonry finishes - interior 1. Vapor barrier	sheet written data photographs drawings or sketches: idicate good, fair, poor on appropriate lines: Good condition N/A Good condition Good condition Good condition Fair condition concrete elements-Fair condition except for noted spalls.

i. Cracks:
1. Location - note beams, columns, other Şệe ஹீove, at infill reasonry
2. Description
j. Spalling:
1. Location - note beams, columns, other None noted.
2. Description
k. Rebar corrosion-check appropriate line:
1. None visible xx
Minor-patching will suffice Significant-but patching will suffice
4. Significant-structural repairs required
I. Samples chipped out for examination in spall areas:
1. No.
Yes - describe color texture, aggregate, general quality
2. 105 describe dolor textere, aggregate, general quality
6. FLOOR AND ROOF SYSTEM
a. Roof:
Describe (flat, slope, type roofing, type roof deck, condition.
Roof is sloped for storm drainage, slopes to internal drains; roof deck consists of a concrete
slab at various locations of the building. High roof is built-up, modified bitumen with a mineral
aggregate cap sheet and was installed within the last year, new flashing; all in very good
condition. Lower level roofs including the entrance canopy are in poor condition and should
be reroofed. 2. Note water tanks, cooling towers, air conditioning equipment, signs, other heavy equipment
and condition of support. There are three rooftop units located at the penthouse roof level.
There were flashed as part of the recently re roofed areas. See Figures 1 and 3.
Note types of drains and scupper and condition of cooling towers, air condition, etc.
There are internal drains throughout the roof areas that appear in good condition.
b. Floor systems(s)
Describe (type of system framing, material, spans, condition)
Concrete slab on grade in all areas of the building, office and warehouse.
c. Inspection – note exposed areas available for inspection, and where it was found necessary to
open ceilings, etc. for inspection of typical framing members.
Structural system throughout was visually exposed and there was access to all structural areas.
7. STEEL FRAMING SYSTEM
a. Description: The main entrance canopy on the north side of the building is structural steel framework consisting of steel joists and beams. This area is concealed and we did not have
visual access. No external deterioration was noted during our site visit.
Visual access. 140 external deterioration was noted during our site visit.
b. Exposed Steel - describe condition of paint & degree of corrosion:
None noted.
c. Concrete or other fireproofing - note any cracking or spalling, and note where any covering
was removed for inspection
none
d. Elevator sheave beams & connections, and machine floor beams – note condition:
This was found to be in fair condition.
8. CONCRETE FRAMING SYSTEM
a. Full description of structural system: The concrete framing system consists of reinforced
concrete columns connecting a flat plate slab system located between the first and eleventh

floors. The Ground floor and penthouse level framing system consists of a pour in place beam and concrete joists framework. There are two stair enclosures at the west and east end of the building that we presumed are used as shear wall elements in addition to the central area elevator core. b. Cracking 1. Not significant 2. Location and description of members affected and type cracking- as noted above we found areas of deterioration in the concrete elements at the ground floor framing and sporadic conditions in various areas of the building. These included the exterior grade walls, balconies and precast concrete railings. See Figures 4, 5, 6, 7, 9 and 10. c. General condition The condition of the main structural system is good. d. Rebar corrosion - check appropriate line: 1. Non visible 2. Location and description of members affected and type cracking As noted above. 3. Significant but patching will suffice 4. Significant - structural repairs required (describe) e. Samples chipped out in spall areas: 1. No. XX 2. Yes, describe color, texture, aggregate, general quality: 9. WINDOWS a. Type (Wood, steel, aluminum, jalousie, single hung, double hung, casement, awning, pivoted, fixed, other) Existing windows are generally aluminum single hung. There are some lower pivoted windows in some of the apartments. The doors to the balconies are aluminum sliders. Most of the windows and doors are original. (non-impact) Some owners have accordion shutters in the balcony units. See Figure 8. b. Anchorage - type & condition of fasteners and latches: anchorage to concrete masonry/concrete appears to be generally in good condition. c. Sealants-type of condition of perimeter sealants and at mullions: Caulking all around appears to be in good condition. d. Interiors seals - type & condition at operable vents: rubber seals in fair condition. e. General condition: Fair condition overall. 10. WOOD FRAMING Type – fully describe if mill construction, light construction, major spans, trusses; None noted. b. Note metal fitting i.e., angles, plates, bolts, split plates, plates, other, and note condition: Not applicable. c. Joints - note if well fitted and still closed: not applicable d. Drainage - note accumulations of moisture: not applicable e. Ventilation -note any concealed spaces not ventilated: not applicable f. Note any concealed spaces opened for inspection: not applicable.

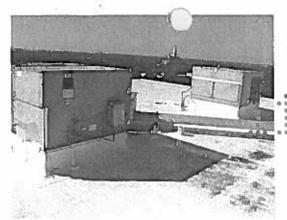


Figure 1-Rooftop Units

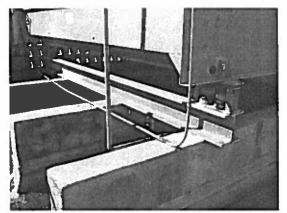


Figure 3-Cooling Tower Supports

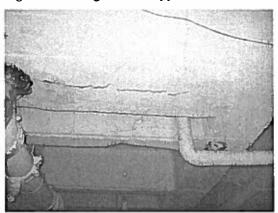


Figure 5-Spalled beam in Basement

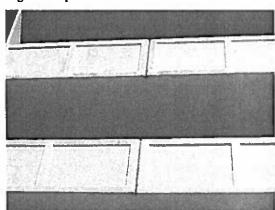


Figure 7-Cracks in South balconies





Figure 2-Exterior wall of Generator room

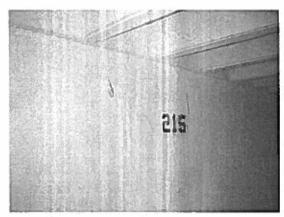


Figure 4-Cracks/Spalls along Garage wall

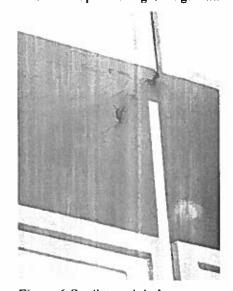


Figure 6-Spalls south balcony

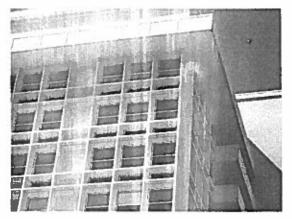


Figure 8-Spalls at Precast Beam at roof

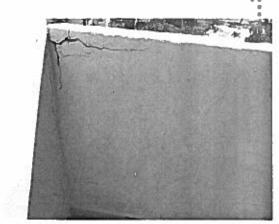


Figure 9- Damaged concrete railing-Unit 1205


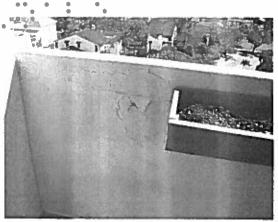


Figure 10- Spalled concrete railing-Unit 1205





February 8, 2012

David Williams Hotel Condominium 700 Biltmore Way Coral Gables, Florida 33134

Attn: Mr. Alex Garcia, President

Re: Electrical repairs for 40 Year Recertification

Gentlemen:

We have performed an electrical inspection of the repair performed to date at your building.

Relighting of the parking garage is complete, Miscellaneous repairs called for in the 40 Year Recertification report have been performed. Penetrations through fire rated partitions have been performed. Corrections of defficiencies in the electrical room at the first floor are complete.

As far as can be determined, all electrical repair work at the Lobby Level and Garage Level have been completed satisfactorily.

Respectfully,

Charles Currier.

CURRIER ASSOCIATES

STATE OF

250 Catalonia Avenue Suite 406 Coral Gables Fl 33134 Tel (305) 446-8655 Fax (305) 446-9230 E-mail cgcurrier@gmail.com

INSPECTION FOR 40 YEAR ELECTRICAL RECERTIFICATION

INSPECTION COMMENCED Date: Jan 22, 2010

INSPECTION COMPLETED Date: Jan 27,2010

INSPECTION MADE BY:

CURRIER ASSOCIATES
CONSULTING ENGINEERS
250 CATALONIA AVE SUITE 406

CORAL GABLES, FLORIDA 33134

SIGNATURE: CLIE

CHARLES CURRIER, P.E.11529

1. DESCRIPTION OF STRUCTURE:

- a. NAME OR TITLE: David William Hotel Condominium
- b. STREET ADDRESS: 700 Biltmore Way, Coral Gables, Fl 33134
- c. LEGAL DESCRIPTION:
- d. FOLIO NUMBER: 0341170340001
- e. OWNER'S NAME: David William Hotel Condominium Assoc., Inc.
- f. OWNER'S MAILING ADDRESS: 700 Biltmore Way Suite 100 Coral Gables, Fl 33134
- g. BUILDING CODE OCCUPANCY CLASSIFICATION:
- h. PRESENT USE: Hotel Condominium
- i. GENERAL DESCRIPTION, TYPE OF CONSTRUCTION, SIZE, NUMBER OF STORIES, AND SPECIAL FEATURES. ADDITIONAL COMMENTS.

14 Story CBS building with one floor basement parking garage.



1.	ELECTRICAL DESCRIPTI PHASE: CONDITION COMMENTS:	ON: SI THR : GOOD	ZE: (2 EE PHA	500A SE	3:.	°FUSES () 6 IGLE PĤAS	יד <i>פ</i> כיו	UIT BR	EAKERS	(x)
	REPAIR RE	QUIRED:										
2.	METER ROOM CLEARANCE COMMENTS:	S: SEE CO	GOOD MMENTS	AT	X) ENDO	REQUIRE F REPORT	S REPAIR	(х)			
	REPAIR RE	QUIRED:	SEE CO	OMME	NTS A	T END OF	REPORT					
3.	GUTTERS LOCATION: CONDITION REPAIR REC		GOOD	FL001	R K)	REQUIRES	S REPAIR	()			
4.	ELECTRICAL	PANELS:	<u>:</u>									
	PANEL: VAR CONDITION: COMMENTS: REPAIR REC	SEE COM	GOOD MENTS	X) AT E	() IND OF	REQUIRES	REPAIR	()			
	PANEL: CONDITION: COMMENTS: REPAIR REQ			()	REQUIRES	REPAIR	()			
	PANEL: CONDITION: COMMENTS: REPAIR REQ			()	REQUIRES	REPAIR	()	9 <u>1</u> 4		
	PANEL: CONDITION: COMMENTS: REPAIR REQU			(}	REQUIRES	REPAIR	()			
	PANEL: CONDITION: COMMENTS: REPAIR REQU			()	REQUIRES	REPAIR	()	a V a V s		

(0, 3/s/c

5.	BRANCH CIRCUITS: IDENTIFIED: YES (MUST BE IDENTIFIED (X) CONDUCTORS: GOOD (X DETERIORATED () REPLACE (COMMENTS: SEE COMMENTS AT END OF REPORT.	
6.	SERVICE GROUNDING: CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS: NONE	
7.	EQUIPMENT GROUNDING: CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS:	
8.	SERVICE CONDUITS/RACEWAYS CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS: NONE	
9.	SERVICE CONDUCTORS AND CABLES CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS: GOOD	
10.	WIRING METHODS:	
	RIGID METALLIC RACEWAYS: GOOD (X) REQUIRES REPAIR (RIGID NONMETALLIC, PVC: GOOD (X) REQUIRES REPAIR (NON-METALLIC CABLE: GOOD () REQUIRES REPAIR (EX CABLE: GOOD () REQUIRES REPAIR (COMMENTS: SEE COMMENTS AT END OF REPORT	X
11.	FEEDER CONDUCTORS CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS: NONE	
12.	EMERGENCY LIGHTING CONDITION: GOOD (X) REQUIRES REPAIR (X) COMMENTS: SEE COMMENTS AT END OF REPORT	
13.	BUILDING EGRESS ILLUMINATION CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS: NONE	

JE3/5/3

7.4	TYTE * TANKS
14	EXIT LIGHTS:
	CONDITION: GOOD (X) REQUIRES REPAIR ()
	COMMENTS: SEE COMMENTS AT END OF REPORT
	0 0 0 0
15.	FIRE ALARM SYSTEM:
	CONDITION: GOOD (X) PROJUTES PERAID (
	COMMENTS: FIRE ALARM SYSTEM WAS BEING TESTED AT TIME OF INSPECTION
	THE OF INSPECTION
16.	SMOKE DETECTORS:
	CONDITION: GOOD (X) PROMITES BERLY (
	COMMENTS: FIRE ALARM SYSTEM WAS BEING TESTED AT TIME OF INSPECTION.
	TIME OF INSPECTION.
17.	EMERGENCY GENERATOR:
	CONDITION: GOOD (X) REQUIRES REPAIR () COMMENTS: NEW GENERATOR INSTALLED IN 2005.
	GENERATOR INSTALLED IN 2005.
18	WIDING IN OPEN OF TABLE COMPANY TO THE TABLE
20.	WIRING IN OPEN OR UNDER COVER PARKING GARAGE AREAS
	CONDITION: GOOD (X) REQUIRES REPAIR (X)
	COMMENTS: SEE COMMENTS AT END OF REPORT.
7.0	ODEN OF THE PROPERTY OF THE PR
19.	OPEN OR UNDERCOVER PARKING SURFACE AND SECURITY LIGHTING
	CONDITION: GOOD () ADDITIONAL ILLUM. REQUIRED (X)
	COMMENTS: IN FOR PERMIT TO UPGRADE EXISTING PARKING AREA LIGHTS.
	TE
20.	SWIMMING POOL WIRING:
	<u>CONDITION:</u> <u>GOOD (</u> X) REQUIRES REPAIR ()
	COMMENTS: NONE
21.	MECHANICAL EQUIPMENT WIRING:
	CONDITION: GOOD (X) REQUIRES REPAIR ()
	COMMENTS: NONE

(3) 18/04

- 22. GENERAL COMMENTS: THE CORRECTIONS DEPICTED IN THIS REPORT AND PHOTOGRAPHS DO NOT NECESSARILY INCLUDE ALL CORRECTIONS THAT HAVE TO BE MADE. THE FOLLOWING ARE ALSO INCLUDED.
- A. ALL BRANCH CIRCUITS IN ALL PANELS SHALL BE IDENTIFIED AND A TYPEWRITTEN PANE DIRECTORY PROVIDED AT ALL PANELS.
- B. ALL DISCONNECT SWITCHES THAT ARE NOT CLEARLY INDICATIVE OF EQUIPMENT PROTECT SHALL BE LABELED AS TO USE.
- C. VERIFY THAT ALL OUTLETS ON ROOF DECK ARE GROUND FAULT PROTECTED. IF NOT, REWITH NEW GFI RECEPTACLES.
- D. WIREMOLD ON POOL DECK CEILING LIGHTS RUN IN DAMP LOCATIONS UNDER ROOF SLAB. WIREMOLD ALLOWED IN DRY LOCATIONS ONLY. REPLACE.
- E. RESTAURANT AREA IS UNDER REPAIR. WHEN REPAIRS ARE COMPLETE RESTAURANT AREA WILL BE INSECTED BY CITY AND ALL DEFECTS SHOULD BE CORRECTED.

As a routine matter, in order to avoid possible misunderstanding, nothing in this report should be construed directly or indirectly as a guarantee for any portion of the building. To the best of our knowledge and ability, this report represents an accurate appraisal of the present electrical condition of the building based upon careful evaluation of observed conditions, to the extent reasonably possible.

19/1/1/25

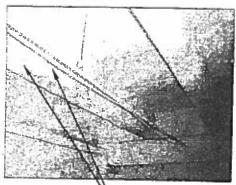


PHOTO #1

BASEMENT PARKING GARAGE PROVIDE SUPPORT OF LOW VOLTAGE CABLES AND REMOVE ABANDONED CABLES AS PER NEC 725.24 AND 725.25



PHOTO #2

NO COMMENT

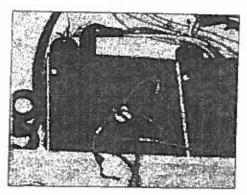


PHOTO #3
BASEMENT PARKING GARAGE
REPLACE MISSING COVER

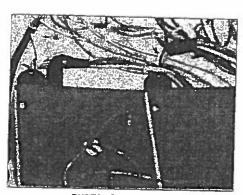


PHOTO #4

BASEMENT PARKING GARAGE
REPLACE MISSING COVER

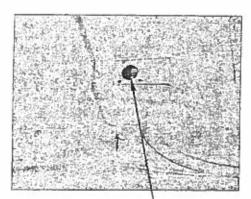


PHOTO #5
BASEMENT PARKING GARAGE
PROVIDE MISSING PLUG

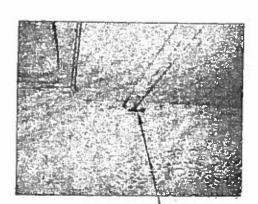


PHOTO IG BASEMENT PARKING GARAGE FIRE SEAL PENETRATION

PAGE A

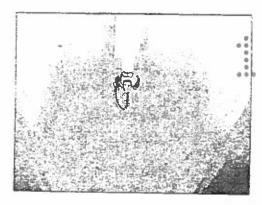


PHOTO \$7
BASEMENT PARKING GARAGE
FIXTURE NOT GROUNDED.
REPLACE PLUG AND RECEPTACLE.
TYPICAL AT SEVERAL PLACES
IN GARAGE.

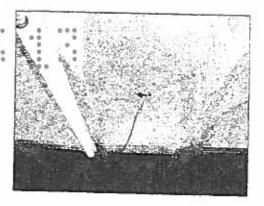


PHOTO #8
BASEMENT PARKING GARAGE
FIXTURE NOT GROUNDED.
REPLACE PLUG AND RECEPTACLE.
TYPICAL AT SEVERAL PLACES
IN GARAGE.

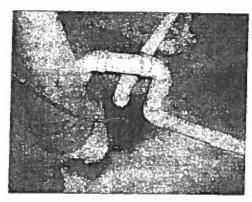


PHOTO #9
BASEMENT PARKING GARAGE
VERIFY PROPER USE OF
GROUNDED CORD.

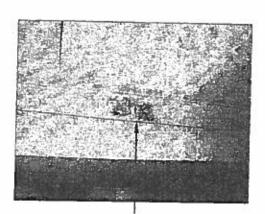


PHOTO #10
BASEMENT PARKING GARAGE
PROVIDE COVER OVER OPEN BOXES

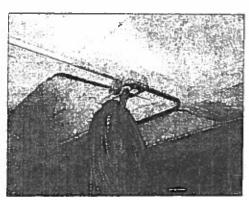


PHOTO #!!
BASEMENT PARKING GARAGE
PROVIDE SEPARATE SUPPORT
FOR EXTENSION CORD. DO NOT
SUPPORT FROM RACEWAY.

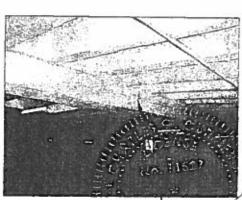


PHOTO #12
BASEMENT PARKING GARAGE
PROVIDE COVER OVER OPEN BOXES

PAGE 5

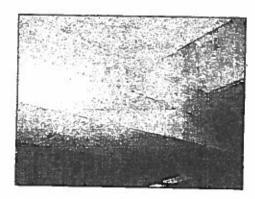


PHOTO #13 BASEMENT PARKING GARAGE NO COMMENTS

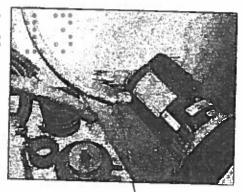


PHOTO #14

BASEMENT PARKING GARAGE CORRECT RACEWAY CONNECTION TO MOTOR

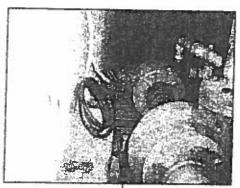


PHOTO #15 | BASEMENT PARKING GARAGE REPLACE COVER

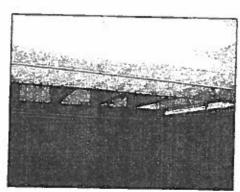


PHOTO #16 BASEMENT PARKING GARAGE NO COMMENT

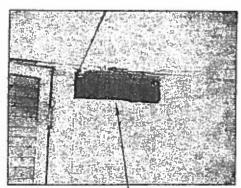


PHOTO #17
BASEMENT PARKING GARAGE
WALL TO PUMP ROOM
FIRE SEAL PENETRATION INTO
PUMP ROOM.

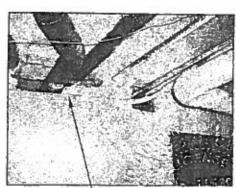


PHOTO #18

BASEMENT PARKING GARAGE
WALL TO PUMP ROOM
FIRE SEAL PENETRATION INTO
PUMP ROOM.

PAGE C

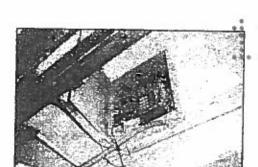


PHOTO #19 \BASEMENT PARKING GARAGE CORRECT WIRING AND CLOSE COVER

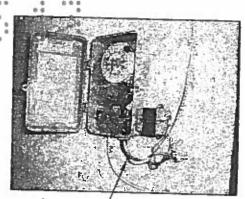


PHOTO #20 | BASEMENT PARKING GARAGE WIRING TO BE ENCLOSED IN RACEWAY OR BOX. CORRECT.

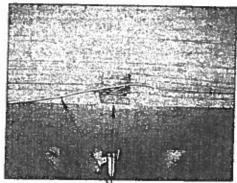


PHOTO #2:
BASSEMENT PARKING GARAGE
PROVIDE COVER ON BOX AND PROVIDE
ADEQUATE SUPPORT FOR LOW VOLTAGE
CABLES.

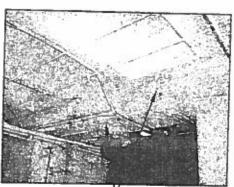


PHOTO #22

BASEMENT PARKING GARAGE
PROVIDE PLUG ON KNOCKOUT AND PROVIDE
ADEQUATE SUPPORT FOR LOW VOLTAGE
CABLES.

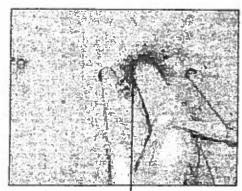


PHOTO #23
BASEMENT PARKING GARAGE
PROVIDE FIRE STOP AT ALL PENETRATIONS.

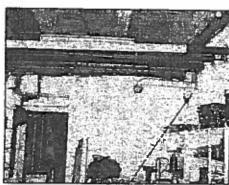


PHOTO #24
DOMESTIC WATER PUMPS ROOM
VERIFY THAT ALL PENETRATIONS IN,
FIRE RATED WALLS ARE SEALED
PAGE D



PHOTO #25 / BASEMENT WATER PUMP ROOM PROVIDE COVER

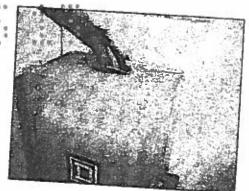


PHOTO #26
BASEMENT WATER PUMP ROOM
PROVIDE PROPER CONNECTION TO BOX.

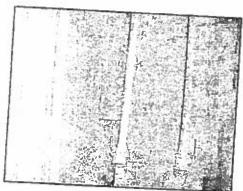


PHOTO #27 BASEMENT. IMPROPER CLEARANCE-CORRECT

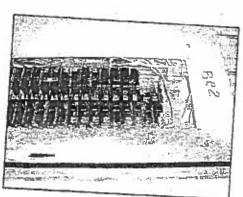


PHOTO #28 BASEMENT PROVIDE COVER OVER BREAKERS IN PANEL.

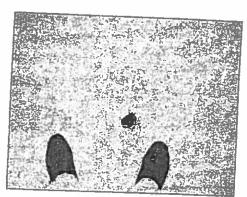


PHOTO #29 SEAL PERFORATION THROUGH FLOOR.

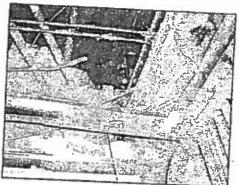


PHOTO #30
FIRST FLOOR ELECTRICAL ROOM
PROVIDE CEILING AT THIS ROOM

12/5/P

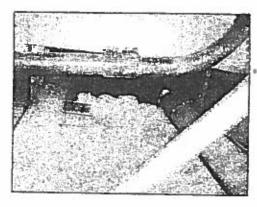


PHOTO #31 FIRST FLOOR ELECTRICAL ROOM SEAL OFF ALL PENETRATIONS.

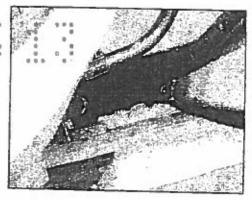


PHOTO #32 FIRST FLOOR ELECTRICAL ROOM SEAL OFF ALL PENETRATIONS.

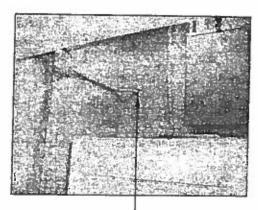


PHOTO #33 | VARIOUS LAUNDRY ROOMS ON TYPICAL FLOORS FIRE SEAL ALL WALL PENETRATIONS.

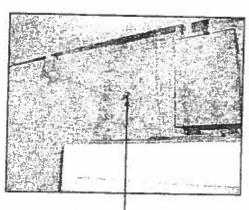


PHOTO #33 | VARIOUS LAUNDRY ROOMS ON TYPICAL FLOORS FIRE SEAL ALL WALL PENETRATIONS.

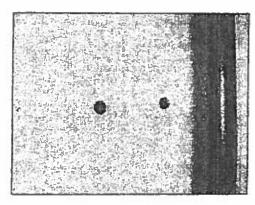


PHOTO #35 TRASH ROOM TYPICAL FLOORS FIRE SEAL WALL OPENINGS.

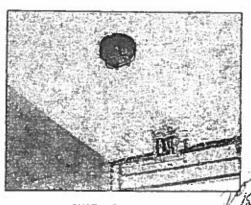


PHOTO 436
BUILDING PENTHOUSE FLOOR
NO COMMENTS

PAGE F

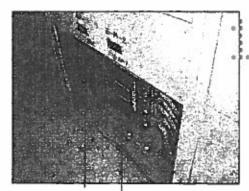


PHOTO #37

PENTHOUSE LEVEL MAIN ELECTRICAL ROOM
PROVIDE COVER OVER OPEN SWITCHBOARD
PROVIDE ADEQUATE LABEL ON USE.

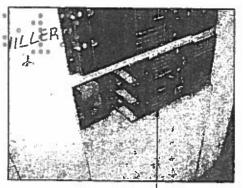


PHOTO #38
PENTHOUSE LEVEL MAIN ELECTRICAL ROOM
PROVIDE COVER OVER OPEN SWITCHBOARD

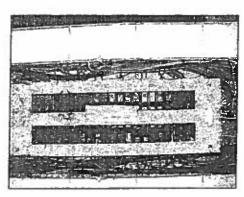


PHOTO \$39
PENTHOUSE LEVEL MAIN ELECTRICAL ROOM
REINSTALL PANEL COVER, LABEL PANEL AND
PROVIDE CIRCUIT DIRECTORY.
(CIRCUIT DIRECTORY REQUIRED AT ALL
PANELS. PROVIDE AS REQUIRED

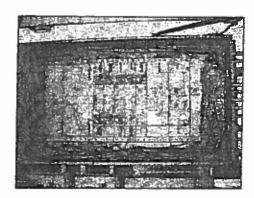


PHOTO #40
PENTHOUSE LEVEL MAIN ELECTRICAL ROOM
REINSTALL PANEL COVER, LABEL PANEL AND
PROVIDE CIRCUIT DIRECTORY.
(CIRCUIT DIRECTORY REQUIRED AT ALL
PANELS. PROVIDE AS REQUIRED

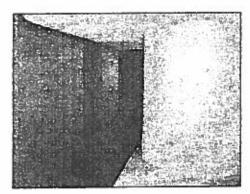


PHOTO #41
ROOF LEVEL MECHANICAL EQUIPMENT ROOM
NO COMMENTS.

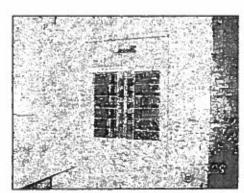


PHOTO #42
ROOF LEVEL MECHANICAL EQUIPMENT ROOM
PROVIDE TYPEWRITTEN PANEL DIRECTORYES! 0
IDENTIFYING BRANCH CIRCUITS

PAGE G



Inspection Check List CITY OF CORAL GABLES



Page: 15

Inspection Schedule for ROBERTO FRANCO
Scheduled for 12/15/2011
ELECCOMMERCIAL / RESIDENTIAL WORK

	2.			MERCIAL .	RESIDENTIA	L WORK	
<u>Permit#</u> EL-11-11-5		<u>ddress</u> 00 BILTMORE	WAY			Owner's Name ALEJANIDRO	GARCIA
Job Descrip REPLACE		RECENT FIXT	URES AT THE	BASEMEN	IT PARKING AI	REA. \$8000	,
Contractor SUN POWE	R & LIGHT I	NC		<u>License #</u> EC13004559)		
Contact Name				Contact Tele			
GUILLERMO GOMEZ				(786) 286-43	91		
Master Peri	mit#: Type: el1	79 FII	NAL ELECTR	ICAL	į.		Time: 00:00
Comments:	Notes:			<u> </u>			<u> </u>
_					v =V		
_	<u> </u>						
-			··· ·				
_			<u> </u>				
_	500.00						
-						71	
-			-				
_	· · · · · · · · · · · · · · · · · · ·		4 1. K				
Approve	ed 🧱 F	Rejected 🔲	Cancelled [] PA 🗌	Re-inspection	Fee OK fo	or TCO Waived
Inspec Signal		Bill	, 	ID	#: <u>650</u>	ê/	Scheduled 12/15/2011 Start Date:
Inspec Na	ctor's ROBERTO FRANCO		со		Inspector's T	elephone Numb	per: (305) 460-5257

9:30 -11

		1	ingeraved	Data	100
	100000000000000000000000000000000000000		d angue = 10		1972
	HSTOME ALC:	1	And an investment		77
		4.	The second secon		
	Contract of the second		gir did were were the second girther and		- 1
14.1 14.1 14.1	7.11	grant and a delay		The same of the sa	
	P1 100 10 15				
¥.	1.00	1		Annahar - Annaharan - Annahara	
	E		(184)	1/8/	13
-		1			
N.	P. P. MA			a management of the special paragraph of the special of the specia	$-\Omega$
		and the second second second	manages, par que	manus start starts	
-	Live in				
(i).				Name and Address and	
*		1 1 %		1	
			Andrews and Control		and the second second
	-	mp m			
			NAME AND ADDRESS OF		

Permit Action Report	CITY OF CORAL GABLES
pmPermitActions	1/25/2016 7:50:07AM

Page: 1

Address: 700 BILTMORE WAY COMMOM AREAS CORAL GABLES, FL 33134-7555		Comments				PROVIDE LETTER OF CERTIFICATION.		
Address: 700 CO	Completed	Ву	asilio	iwebuser		mlopez	areyes	
RTIFICATION	Completion Completion	Code	comp			reject	apvd	
rc010 - BUILDING RE CERTIFICATION	Completion	Date	11/15/2013	11/15/2013		11/15/2013	11/18/2013	
Permit type: rc010 - BUILDING RE CERTIFICATION Routing queue: rc012 - STRUCTURE CERTIFICATION		Action Description	CALCULATE FEES	COLLECT FEES	BUILDING PLAN REVIEW	BUILDING PLAN REVIEW	ELECTRICAL PLAN REVIEW	GENERATE LETTER
11-2507	Action	Code	calc fees	collect	prbuild	prbuild	prelec	letter
Permit #: RC-13-11-2507 Master permit #:		Group # - Name	1 - BOARDS - GENERATE F calc fees	2 - CASHIER	3 - PLAN REVIEW	3 - PLAN REVIEW	3 - PLAN REVIEW	4 - RF CFRTIFIED I ETTER letter



BEFORE THE CONSTRUCTION REGULATION BOARD OF THE CITY OF CORAL GABLES

CITY OF CORAL GABLES,

Case # 16-4689

Petitioner.

VS.

DAVID WILLIAM HOTEL CONDOMINIUM ASSOCIATION, INC. a Florida not for profit corporation

Respondent.

NOTICE OF UNSAFE STRUCTURE VIOLATION FOR FAILURE TO RECERTIFY AND NOTICE OF HEARING

Date: January 22, 2016

To:

Condominium Association

David William Hotel Condominium

Association, Inc.

700 Biltmore Way, Suite 100

Coral Gables, FL 33134-7555

Return receipt number:

91 7108 2133 3932 6905 4185

Condominium Association (Registered

Agent)

David William Hotel Condominium

Association, Inc.

c/o SKRLD, Inc.

Registered Agent

201 Alhambra Circle, 11th Floor

Coral Gables, FL 33134-5107

Return receipt number:

71 7108 2133 3932 6905 4178

Re: The fourteen-story residential condominium buildings consisting of 196 units ("Structure"), built in 1963 (50-year recertification required), and located at 700 Biltmore Way, Coral Gables, FL 33134-7428, legally described as Lots 6 thru 22, Block 10, of PLAT CORAL GABLES BILTMORE SECTION, according to the Plat thereof, as recorded in Plat Book 20, Page 28, of the Public Records of Miami-Dade County, Florida; and having folio number 03-4117-034-0001 ("Property").

CITY'S EXHIBIT 5 The City of Coral Gables ("City") Building Official has inspected the records relating to the Structure in accordance with Article III, Chapter 105 of the City Code, pertaining to unsafe structures, and Section 8-11 of the Miami-Dade County Code, as applicable in the City, pertaining to existing buildings. The Structure is hereby declared unsafe by the Building Official and is presumed unsafe pursuant to Section 105-186(j)(13) of the City Code for failure to timely comply with the maintenance and recertification requirements of the Florida Building Code or Section 8-11 of the Miami-Dade County Code as follows:

On March 1, 2013, the City sent the Property Owner a 90-day Notice of Required Inspection requesting an inspection report conforming to the minimum inspection procedural guidelines as issued by the Miami-Dade County Board of Rules and Appeals, pursuant to Section 8-11(f) of the Miami-Dade County Code ("Report").

On September 11, 2013 and June 2, 2015, the City sent the Property Owner the City sent the Property Owner notices that the Report was past due.

The Report, submitted to the City on November 15, 2013, stated that the Structure did not meet the minimum requirements to be recertified as structurally and electrically safe. The Report noted that the following items required repair or modification: **Electrical:** 1) circuit breakers; 2) all branch circuits in all panels shall be identified and a typewritten pane directory provided at all panels; 3) all disconnected switches that are not clearly indicative of equipment protect shall be labeled as to use; 4) verify that all outlets on roof deck are ground fault protected; 5) pool deck ceiling lights, replace wiremold in dry locations only; 6) restaurant area to be inspected upon completion of work; and 7) replace 105 fluorescent fixtures at the basement parking area.

On November 18, 2013, the City notified the Owner that it must complete the repairs and submit a letter from the architect or engineer who prepared the Report stating that the Structure now meets the minimum requirements ("Compliance Report").

To date, the Owner has not a) completed the required repairs and b) submitted a letter from the architect or engineer who prepared the Report stating that the Structure now meets the minimum requirements ("Compliance Report")(collectively referred to as "Required Action").

Therefore, this matter is set for hearing before the City's Construction Regulation Board ("Board") in the Commission Chambers, City Hall, 405 Biltmore Way, Coral Gables, Florida 33134, on February 8, 2016, at 2:00 p.m.

You may appeal the decision of the Building Official to the Board by appearing at the hearing. You have the right to be represented by an attorney and may present and question witnesses and evidence, however, formal rules of evidence shall not apply. Failure to appear at the hearing will result in the matter being heard in your absence. Please be advised that, if someone other than an attorney will be attending the hearing on your behalf, he or she must provide a power of attorney from you at the time of the hearing. Requests for continuance must be made in writing to Belkys

Garcia, Sccretary to the Board, at City of Coral Gables, Development Services Department, 405 Biltmore Way, 3rd Floor, Coral Gables, FL 33134, <u>bgarcia@coralgables.com</u>, tel: (305) 460-5229.

If the Required Action is not completed before the above hearing date, the Building Official may order that the structure be vacated, boarded, secured, and posted to prevent further occupancy until the Required Action is completed. The Building Official may also order demolition of the Structure and recover the costs incurred against the Property and the Owner of record.

If the Property Owner or other interested party does not take all Required Action or appeal the decision of the Building Official, the Construction Regulation Board may enter an order of demolition and assess all costs of the proceedings and demolition and other Required Action for which the City shall have a lien against the Property and the Property Owner.

Please contact Virginia Goizueta, Building Services Coordinator, tel.: (305) 460-5250. email: vgoizueta@coralgables.com, or Manuel Z. Lopez, P.E., Building Official. tel.: (305) 460-5242. email: mlopez@coralgables.com. The Development Services Department's hours are Monday though Friday, 7:30 a.m. to 3:30 p.m.

Please govern yourself accordingly.

CERTIFICATE OF SERVICE

I HEREBY CERTIFY that, on January 22. 2016, a true and correct copy of the foregoing notice was served via certified mail, return receipt requested, by first class mail, via email at any e-mail address indicated above, and by hand-delivery or posting at the Property.

Manuel Z. Lopez

Bailding Officia

NOTICES

Any person who acts as a lobbyist pursuant to the City of Coral Gables Ordinance No. 2006-11, must register with the City Clerk, prior to engaging in lobbying activities before the city staff, boards, committees and or the City Commission. A copy of the Ordinance is available in the Office of the City Clerk, City Hall.

Pursuant to Section 286.0105, Florida Statutes, if a person decides to appeal any decision made by the Board, with respect to any matter considered at such hearing or meeting, he or she will need a record of the proceedings, and that, for such purpose, he or she may need to ensure that a verbatim record of the proceedings is made; which record includes the testimony and evidence upon which the appeal is to be based. Although a court reporter usually attends the hearing at the City's cost, the City is not required to provide a transcript of the hearing, which the Respondent may request at the Respondent's cost.

ADA Assistance: The City complies with the provisions of the American with Disabilities Act. Individuals with disabilities requiring special accommodations or assistance should contact Ernesto Pino. Assistant Public Works Director, at (305) 460-5004, with requests for auxiliary aids or services at least one business day before the hearing in order to request such assistance.




CITY OF CORAL GABLES DEVELOPMENT SERVICES DEPARTMENT Affidavit of Posting

Complaint/Case #: 16-4689
Title of Document Posted: Construction Regulation Board Case
I, DWNIS POIN, DO HEREBY SWEAR/AFFIRM THAT
THE AFOREMENTIONED NOTICE WAS PERSONALLY POSTED, BY ME, AT THE
ADDRESS OF 700 Biltmore Way, ON 1-22-16
AT 9.15 pm.
Dennis Por Employee's Printed Name Employee's Signature
STATE OF FLORIDA) ss. COUNTY OF MIAMI-DADE)
Sworn to (or affirmed) and subscribed before me this 22 hal day of <u>Jakuaky</u> , in the year 20 <u>Lakest</u> , by <u>Dekked for the personally known to me.</u>
My Commission Expires:
BELKYS GARCIA Commission # FF 186232 Expires April 29, 2019 Bonded Thru Troy Fain Insurance 800-385-7018

700 Biltmore Way



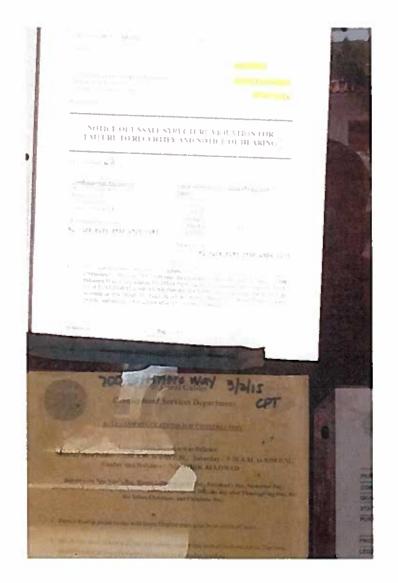

FLORIDA DEPARTMENT OF STATE Division of Corporations



Detail by Entity Name

Florida Not For Profit Corporation

DAVID WILLIAM HOTEL CONDOMINIUM ASSOCIATION, INC.

Filing Information

Document Number

N31836

FEI/EIN Number

65-0180710

Date Filed

04/20/1989

State

FL

Status

ACTIVE

Last Event

AMENDMENT

Event Date Filed

04/19/2010

Event Effective Date

NONE

Principal Address

700 BILTMORE WAY - SUITE 100 CORAL GABLES, FL 33134

Changed: 11/03/2008

Mailing Address

700 BILTMORE WAY - SUITE 100 CORAL GABLES, FL 33134

Changed: 02/08/2012

Registered Agent Name & Address

SKRLD, Inc.

201 Alhambra Circle, 11th Floor

Coral Gables, FL 33134

Name Changed: 06/28/2013

Address Changed: 06/28/2013

Officer/Director Detail

Name & Address

Title PD

GARCIA, ALEJANDRO



700 BILTMORE WAY APT. 1119 CORAL GABLES, FL 33134

Title VPSD

FOURNARIS, ANA M 700 BILTMORE WAY APT 1202 CORAL GABLES, FL 33134

Title TD

BUTLER, ROBERT 1200 ANASTASIA AVE. CORAL GABLES, FL 33134

Annual Reports

Report Year	Filed Date
2013	04/16/2013
2014	04/23/2014
2015	04/15/2015

Document Images

04/15/2015 ANNUAL REPORT	View image in PDF format
04/23/2014 ANNUAL REPORT	View image in PDF format
04/16/2013 ANNUAL REPORT	View image in PDF format
04/25/2012 ANNUAL REPORT	View image in PDF format
02/08/2012 ANNUAL REPORT	View image in PDF format
04/04/2011 ANNUAL REPORT	View image in PDF format
11/30/2010 Reg. Agent Change	View image in PDF format
04/19/2010 Amendment	View image in PDF format
01/21/2010 ANNUAL REPORT	View image in PDF format
04/20/2009 ANNUAL REPORT	View image in PDF format
11/03/2008 Reg. Agent Change	View image in PDF format
01/15/2008 ANNUAL REPORT	View image in PDF format
04/06/2007 ANNUAL REPORT	View image in PDF format
07/20/2006 Off/Dir Resignation	View image in PDF format
07/07/2006 ANNUAL REPORT	View image in PDF format
04/10/2006 ANNUAL REPORT	View image in PDF format
04/22/2005 ANNUAL REPORT	View image in PDF format
07/26/2004 ANNUAL REPORT	View image in PDF format
02/10/2003 ANNUAL REPORT	View image in PDF format
05/13/2002 ANNUAL REPORT	View image in PDF format

05/05/2001 ANNUAL REPORT	View image in PDF format
01/20/2000 ANNUAL REPORT	View image in PDF format
02/18/1999 ANNUAL REPORT	View image in PDF format
08/19/1998 ANNUAL REPORT	View image in PDF format
03/05/1997 ANNUAL REPORT	View image in PDF format
06/17/1996 ANNUAL REPORT	View image in PDF format

Copperfect Could Provide Persist.

Scale of Horida, Demartment et stafé.

FLORIDA DEPARTMENT OF STATE DIVISION OF CORPORATIONS



Detail by Entity Name

Florida Profit Corporation

SKRLD, INC.

Filing Information

Document Number

L17514

FEI/EIN Number

65-0241847

Date Filed

09/19/1989

State

FL

Status

ACTIVE

Last Event

REINSTATEMENT

Event Date Filed

03/05/1991

Principal Address

201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Changed: 03/20/2013

Mailing Address

201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Changed: 03/20/2013

Registered Agent Name & Address

DE LA TORRE, HELIO 201 ALHAMBRA CIR.

#1100

CORAL GABLES, FL 33134

Name Changed: 06/04/2001

Address Changed: 03/20/2013

Officer/Director Detail

Name & Address

Title D

SIEGFRIED, STEVEN M

201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Title D

RIVERA, OSCAR R 201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Title D

LERNER, LISA A 201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Title D

DE LA TORRE, HELIO 201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Title D

SOBEL, STUART H 201 ALHAMBRA CIR. #1100 CORAL GABLES, FL 33134

Annual Reports

Report Year	Filed Date
2013	03/20/2013
2014	02/28/2014
2015	04/07/2015

Document Images

04/07/2015 ANNUAL REPORT	View image in PDF format
02/28/2014 ANNUAL REPORT	View image in PDF format
03/20/2013 ANNUAL REPORT	View image in PDF format
03/16/2012 ANNUAL REPORT	View image in PDF format
04/12/2011 ANNUAL REPORT	View image in PDF format
03/30/2010 ANNUAL REPORT	View image in PDF format
02/25/2009 ANNUAL REPORT	View image in PDF format
03/31/2008 ANNUAL REPORT	View image in PDF format
03/26/2007 ANNUAL REPORT	View image in PDF format
04/03/2006 ANNUAL REPORT	View image in PDF format
03/14/2005 ANNUAL REPORT	View image in PDF format

04/19/2004 ANNUAL REPORT	View image in PDF format
04/11/2003 ANNUAL REPORT	View image in PDF format
04/17/2002 ANNUAL REPORT	View image in PDF format
06/04/2001 ANNUAL REPORT	View image in PDF format
03/08/2000 ANNUAL REPORT	View image in PDF format
03/24/1999 ANNUAL REPORT	View image in PDF format
03/19/1998 ANNUAL REPORT	View image in PDF format
03/27/1997 ANNUAL REPORT	View image in PDF format
03/18/1996 ANNUAL REPORT	View image in PDF format
03/21/1995 ANNUAL REPORT	View image in PDF format

Copyright & and Trivacy Princies Size of Plonds, Esparanest of State

Goizueta, Virginia

From:

Lopez, Manuel

Sent:

Monday, June 08, 2015 7:33 AM

To:

Goizueta, Virginia

Subject:

FW: Your cert. letter dated June 02 2015 reg. David William Recertification

Attachments:

NOC Lemark and DW.pdf; Building Permit BL 14-01-1746.pdf; Letter from City of CG

Dev Svces Dept..pdf

Importance:

High

FYI

Manuel Z. Lopez P.E. Building Official City of Coral Gables Development Services Department 405 Biltmore Way, 3rd Floor Coral Gables Florida, 33134 305-460-5242



Celebrating 90 years of a dream realized.

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Sunday, June 07, 2015 9:21 PM

To: Lopez, Manuel

Cc: 'Alisa Cepeda'; 'Roberto Hernandez'; 'Maria Carrasquillo'

Subject: Your cert. letter dated June 02 2015 reg. David William Recertification

Importance: High

Dear Mr. Lopez:

We are in receipt of attached letter dated June 02, 2015.

City inspectors come here regularly once a month/ and or as agreed since inception of this project on January 05, 2015.

However, I have copied the Threshold Engineer (Special Inspector) registered with the City for this project, Mr. Roberto Hernandez

from RH Engineering, whose office will supply the City with any report you may requirery'S



Respectfully,

Holger Lutz, LCAM, CMCA **Property Manager**

David William Hotel Condominium Association, Inc. 700 Biltmore Way, Suite 100 Coral Gables, FL 33134

phone:

(305) 529-9050

Fax:

(305) 529-9041 Front Desk: (305) 903-1867

manager@davidwilliamcondo.com



www.davidwilliamcondo.com

CONFIDENTIALITY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above. If you are not the intended recipient, you are on notice that any unauthorized disclosure, copying, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is prohibited. If you receive this message in error, or are not the named recipient, please notify the sender at the email address above and delete this email from your computer. Receipt by any other than the named recipient is not a waiver of any attorney-client, work product or their applicable privilege. Thank you. Este mensaje puede contener información confidencial. Si usted no es el destinatario y lo recibe por error, por favor no haga uso del mismo y bórrelo de su máquina. Gracias.

Please consider the environment before printing this email

Goizueta, Virginia

From:

Lopez, Manuel

Sent:

Tuesday, June 30, 2015 1:56 PM

To:

Goizueta, Virginia

Subject:

RE: Request for Time Extension/ 40 recertification project David William Hotel

Condominium/ follow up

Give them 60 days.

Manuel Z. Lopez P.E. Building Official City of Coral Gables Development Services Department 405 Biltmore Way, 3rd Floor Coral Gables Florida, 33134 305-460-5242



Celebrating 90 years of a dream realized.

From: Goizueta, Virginia

Sent: Tuesday, June 30, 2015 1:46 PM

To: Lopez, Manuel

Sulject: FW: Request for Time Extension/ 40 recertification project David William Hotel Condominium/ follow up

In rtance: High

Manny,

What should I do?

(')irginia Gaizueta Building Service Coordinator

City of Coral Gables

Development Services Department

405 Biltmore Way, 3rd Floor

Coral Gables, Florida 33134

Office: 305-460-5250



Celebrating 90 years of a dream realized.

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Tuesday, June 30, 2015 10:29 AM To: Goizueta, Virginia; Lopez, Manuel

Cc: 'Roberto Hernandez'; 'Alisa Cepeda'; 'María Carrasquilla'

Subject: RE: Request for Time Extension/ 40 recertification project David William Hotel Condominium/ follow up

Importance: High

Good day Mr. Lopez:

Would you be so kind and brief us on the status of our request for extension?

Thank you.

On behalf of the Board of Directors,

Holger Lutz, LCAM, CMCA Property Manager

David William Hotel Condominium Association, Inc.

700 Biltmore Way, Suite 100 Coral Gables, FL 33134

phone:

(305) 529-9050

Fax:

(305) 529-9041 Front Desk: (305) 903-1867

manager@davidwilliamcondo.com



www.davidwilliamcondo.com

CONFIDENTIALITY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above. If you are not the intended recipient, you are on notice that any unauthorized disclosure, copying, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is prohibited. If you receive this message in error, or are not the named recipient, please notify the sender at the entail address above and delete this email from your computer. Receipt by any other than the named recipient is not a waiver of any attorney-client, work product or their applicable privilege. Thank you. Este mensaje puede contener información confidencial. Si usted no es el destinatario y lo recibe por error, por favor no haga uso del mismo y bórrelo de su máquina. Gracias.

Please consider the environment before printing this email

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Thursday, June 11, 2015 8:32 PM

To: 'Goizueta, Virginia'; 'mlopez@coralgables.com'

Cc: 'Roberto Hernandez'; 'Alisa Cepeda'; 'María Carrasquilla'

Subject: RE: Request for Time Extension/ 40 recertification project David William Hotel Condominium

Importance: High

Dear Mr. Lopez:

Please accept attached request for time extension for our 40 year recertification project. Kindly confirm receipt of this communiqué.

Thank you very much.

Respectfully,

On behalf of the Board of Directors,

Holger Lutz, LCAM, CMCA **Property Manager**

David William Hotel Condominium Association, Inc. 700 Biltmore Way, Suite 100 Coral Gables, FL 33134

phone:

(305) 529-9050

Fax:

(305) 529-9041 Front Desk: (305) 903-1867

manager@davidwilliamcondo.com



www.davidwilliamcondo.com

CONFIDENTIALATY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above. If you are not the intended recipient, you are on notice that any unauthorized disclosure, copying, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is probibited. If you receive this message in error, or are not the named recipient, please notify the sender at the email address above and delete this email from your computer. Receipt by any other than the named eccipient is not a waiver of any attorney-client, work product or their applicable privilege. Thank you, Este mensaje puede contener información confidencial. Si usted no es el destinatario y lo recibe por error, por favor no haga uso del mismo y bórrelo de su máquina. Gracias.

Please consider the environment before printing this email

From: Goizueta, Virginia [mailto:vgoizueta@coralgables.com]

Sent: Monday, June 08, 2015 11:47 AM

To: 'Holger Lutz'

Cc: 'Roberto Hernandez'; 'Alisa Cepeda'; Lopez, Manuel

Subject: RE: Your cert. letter dated June 02 2015 reg. David William Recertification/ follow up

Yes,

Please E-mail the Building Official Manuel Z. Lopez, requesting a time certain extension and the reason of your request. He can be reached at mlopez@coralgables.com

Virginia Goizueta

Building Service Coordinator City of Coral Gables Development Services Department 405 Biltmore Way, 3rd Floor Coral Gables, Florida 33134

Office: 305-460-5250



Celebrating 90 years of a dream realized.

Goizueta, Virginia

From:

Goizueta, Virginia

Sent:

Wednesday, January 06, 2016 8:47 AM

To:

'Holger Lutz'

Cc:

'Roberto Hernandez'; 'Alisa Cepeda'; Lopez, Manuel

Subject:

RE: Recertification Report(s) DWHC

Importance:

High

Good morning Mr. Lutz,

Our files indicate a recertification report was submitted to the City on 11/14/13 for the Structural and Electrical status of the structure as required by Miami-Dade County. The report concluded Electrical repairs where required in order to comply with the Recertification.

The report was accepted for processing but was rejected by the Building Official who required the Engineer Recertification Letter which is a part of the Recertification process.

In order to achieve compliance a new report (Structural & Electrical) must be submitted indicating there are no deficiencies and shall include a letter from the Engineer recommending the City issues the recertification.

At this time, the Building Official will not issue additional administrative extensions on this property therefore; the property will be scheduled for the February 2016 Construction Regulation Board meeting. Please note the Board will hear your case and provide you with a compliance schedule.

Thank you

(')irginia Goizueta
Building Service Coordinator

City of Coral Gables

Development Services Department

405 Biltmore Way, 3rd Floor Coral Gables, Florida 33134

Office: 305-460-5250



Celebrating 90 years of a dream realized.

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Tuesday, January 05, 2016 7:38 PM

To: Goizueta, Virginia

Cc: 'Roberto Hernandez'; 'Alisa Cepeda' **Subject:** RE: Recertification Report(s) DWHC

Importance: High

Mrs. Goizueta:

Pardon the delay in answering, your mail was sitting in my spam box.

I believe there is some confusion over the recertification report(s). The reason for my e mail and our letter dated December 08, 2015

was to inform the building official of the progress made and to invite Mr. Lopez to see the progress first hand.

It was not designed to replace the approved format by Miami Dade, as we are close but have not yet reached the end of the project

due to the circumstances described.

You had also sent us an attachment for the 40 electrical recertification, this work was completed and accepted by the City of

CG on Nov 18, 2013 (see attached and below correspondence confirming acceptance).

On behalf of the Board of Directors.

Mr. Lutz: thank you and the same to you and yours.

The Electrical Official accepted the electrical portion of that report on 11/18/2013. All that is now missing is the required repairs and the new report stating that the building is structurally sound.

As always please do not hesitate to contact me again if I can be of any further assistance, have a great day.

Antonio Silió
Plans Processor
Coral Gables
Asilio@coralgables.com.

305-569-1807

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Friday, January 03, 2014 11:23 AM

To: Silio, Antonio

Subject: RE: 40 year recertification David William follow up #2

First of all, the best wishes for a healthy and prosperous 2014.

I know our 40 year recertification project engineer Roberto Hernandez visited you and City Hall in December and we are going to have our Pre-bid meeting with several contractors soon, this month.

I also wanted to get back to the <u>Electrical Recertification</u>, as you remember, I presented the attached to you in our meeting and we were wondering if the documentation suffices to satisfy the City's requirements.

If not, I will have to contact the electrical engineer Charles Currier again and ask him to provide the exact report that you require.

Please advise.

Thank you very much.

Holger Lutz, LCAM, CMCA Property Manager

Holger Lutz , LCAM, CMCA Property Manager

David William Hotel Condominium Association, Inc.

700 Biltmore Way, Suite 100 Coral Gables, FL 33134

Front Desk: (305) 903-1867

phone:

(305) 529-9050

Fax:

(305) 529-9041

manager@davidwilliamcondo.com



www.davidwilliamcondo.com

CONFIDENTIALITY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above. If you are not the intended recipient, you are on notice that any unauthorized disclosure, copying, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is prohibited. If you receive this message in error, or are not the named recipient, please notify the sender at the email address above and delete this small from your computer. Receipt by any other than the named recipient is not a waiver of any attorney-client, work product or their applicable privilege. Thank you. Ester mensaje puede contener información confidencial. Si usted no estel destinatario y lo recibe por error, por favor no haga uso del mismo y bórrelo de su máquina. Gracias.

Please consider the environment before printing this email

From: Goizueta, Virginia [mailto:vqoizueta@coralqables.com]

Sent: Wednesday, December 16, 2015 8:57 AM

To: manager@davidwilliamcondo.com **Subject:** Recertification Report

Mr. Lutz.

The inspection results we have received from RH Engineering group dated October 21, 2015 cannot be accepted as the recertification report.

Please provide a report as per Miami-Dade County approved format, please see attached.

Building Service Coordinator

City of Coral Gables

Virginia Goizueta

Development Services Department

405 Biltmore Way, 3rd Floor Coral Gables, Florida 33134

Office: 305-460-5250



Celebrating 90 years of a dream realized.

Please Note: Florida has a very broad Public Records Law. Most written communications to or from State and Local Officials regarding State or Local business are public records available to the public and media upon request. Your email communications may therefore be subject to public disclosure.

Silio, Antonio

From:

Holger Lutz <manager@davidwilliamcondo.com>

Sent:

Friday, January 03, 2014 2:44 PM

To:

Silio, Antonio

Subject:

RE: 40 year recertification David William follow up #2/ thank you

Thank you for your quick reply.

We are working on the concrete restoration.

Best, Holger

Holger Lutz, LCAM, CMCA Property Manager

David William Hotel Condominium Association, Inc. 700 Biltmore Way Coral Gables, FL 33134

phone: (305) 529-9050 Fax: (305) 529-9041 Front Desk: (305) 903-1867

manager@davidwilliamcondo.com



CONFIDENTIALITY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above. If you are not the intended recipient, you are on notice that any unauthorized disclosure, copying, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is prohibited. If you receive this message in error, or are not the named recipient, please notify the sender at the email address above and delete this email from your computer. Receipt by any other than the named recipient is not a waiver of any attorney-client, work product or their applicable privilege. Thank you.

From: Silio, Antonio [mailto:asilio@coralgables.com]

Sent: Friday, January 03, 2014 11:40 AM

To: 'Holger Lutz'

Subject: RE: 40 year recertification David William follow up #2

Mr. Lutz; thank you and the same to you and yours.

The Electrical Official accepted the electrical portion of that report on 11/18/2013. All that is now missing is the required repairs and the new report stating that the building is structurally sound.

As always please do not hesitate to contact me again if I can be of any further assistance, have a great day.

Antonio Silió
Plans Processor
Coral Gables
Asilio@coralgables.com.

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Friday, January 03, 2014 11:23 AM

To: Silio, Antonio

Subject: RE: 40 year recertification David William follow up #2

First of all, the best wishes for a healthy and prosperous 2014.

I know our 40 year recertification project engineer Roberto Hernandez visited you and City Hall in December and we are going to have our

Pre-bid meeting with several contractors soon, this month.

I also wanted to get back to the <u>Electrical Recertification</u>, as you remember, I presented the attached to you in our meeting

and we were wondering if the documentation suffices to satisfy the City's requirements.

If not, I will have to contact the electrical engineer Charles Currier again and ask him to provide the exact report that you require.

Please advise.

Thank you very much.

Holger Lutz, LCAM, CMCA Property Manager

David William Hotel Condominium Association, Inc. 700 Biltmore Way Coral Gables, FL 33134

phone: (305) 529-9050 Fax: (305) 529-9041 Front Desk: (305) 903-1867

manager@davidwilliamcondo.com





HAPPY NEW YEAR!

CONFIDENTIALITY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above, If you are not the intended recipient, you are on notice that any unauthorized disclosure, copying, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is prohibited. If you receive this

From: Silio, Antonio [mailto:asilio@coralgables.com]
Sent: Thursday, November 14, 2013 1:38 PM

To: 'Holger Lutz'

Subject: RE: 40 year recertification David William follow up

Thank you for your attention to this matter, I am looking forward to completing our task. Thank you for contact information I will contact you if I have any questions or concerns regarding the David Williams.

Respectfully

Antonio Silió
Plans Processor
Coral Gables
Asilio@coralgables.com.
305-569-1807

From: Holger Lutz [mailto:manager@davidwilliamcondo.com]

Sent: Thursday, November 14, 2013 12:38 PM

To: Silio, Antonio Cc: 'Maria Carrasquillo'

Subject: 40 year recertification David William follow up

Mr. Silio:

Thank you again for your assistance with our 40 recertification.

We already cut the check and I will advise when signed and dropped off at City Hall.

Below you have my contact information, my cell is (305) 606 3122 should it become necessary to reach me in an urgent matter.

Kindest regards,

Holger Lutz, LCAM, CMCA Property Manager

David William Hotel Condominium Association, Inc. 700 Biltmore Way Coral Gables, FL 33134

phone: (305) 529-9050 Fax: (305) 529-9041

manager@davidwilliamcondo.com



CONFIDENTIALITY NOTICE: The information in this electronic message may be privileged and confidential and is intended for the use of the individual and/or entity named above. If you are not the intended recipient, you are on notice that any unsufficient distorbing, distribution, or taking any action in reliance on the contents of the electronically transmitted materials is prohibited. If you receive this message in error, or are not the named recipient, please notify the sender at the enail address above and delete this email from your computer. Receipt by any other than the named recipient is not a waiver of any attented-recipient, work product or their applicable privilege. Thank you.

Please Note: Florida has a very broad Public Records Law. Most written communications to or from State and Local Officials regarding State or Local business are public records available to the public and media upon request. Your email communications may therefore be subject to public disclosure.

Please Note: Florida has a very broad Public Records Law. Most written communications to or from State and Local Officials regarding State or Local business are public records available to the public and media upon request. Your email communications may therefore be subject to public disclosure.

Search Results Page 1 of 3



Home

Citizen Services

Business Services

Back to Coral Gables.com

Permits and Inspections: Search Results

Logon

Help

Contact

M New Permit Search

Permit Search Results

Permit#:	App. Date	Street Address	Туре	Description	Status	Issue Date	Final Date	Fees Du
BL-08-01-1034	01/24/2008	700 BILTMORE WAY	INT / EXT ALTERATIONS	INTERIOR ALTERATIONS AND EXTERIOR PIPELINE UNIT 1401,1402 \$18,000	final	06/22/2010	06/22/2010	0.00
BL-09-01-2206	01/23/2009	700 BILTMORE WAY	MISCELLANEOUS WORK	PATCH DRYWALL CEILING AND WALLPAPER #2,400 AT #1201	stop work	01/23/2009		0.00
BL-09-04-2150	04/10/2009	700 BILTMORE WAY	INT / EXT ALTERATIONS	INT RENOV & FINISH & PAINT NEWLY CLOSED OPENING \$14000	final	05/07/2009	10/07/2009	0.00
BL-09-10-2341	10/07/2009	700 BILTMORE WAY	ROOF / LIGHT WEIGHT CONC	APPLY GACO WESTERN ROOF COATING SYSTEMS TO MAIN ROOF AREA \$28,727	final	10/07/2009	10/30/2009	0.00
BL-10-05-4675	05/24/2010		SHUTTERS / LOUVERS / SECURITY BARS	INSTALL (1) ACCORDION HURRICANE SHUTTER (AT POOL - ROOF)\$3469	pending			0.00
BL-10-06-4556	06/17/2010	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMMERCIAL INTERIOR ALTERATIONS R-PH & UNIT#R-5(ROOF TOP PH AND R-5 UNITS \$1,500	final	07/22/2010	08/04/2010	0.00
BL-10-10-4459	10/08/2010	700 BILTMORE WAY	POOL / SPA / FOUNTAIN / POND	POOL IMPROVEMENTS (TILING, RESURFACING, WATERPROOFING) #74,000	final	11/04/2010	05/17/2011	0.00
BL-11-01-4778	01/13/2011		DOOR/GARAGE DOOR/SHUTTER/WINDOW	INSTALL 1 SLIDING DOOR AND 3 IMPACT WINDOWS \$21,240	final	01/31/2011	04/14/2011	0.00
BL-11-02-5626	02/18/2011	700 BILTMORE WAY	ROOF / LIGHT WEIGHT CONC	RE ROOF OF FLAT PORTION AT ENTRANCE W/ POLYGLASS \$12630	final	02/23/2011	03/10/2011	0.00
BL-11-03-5758	03/11/2011	700 BILTMORE WAY	POOL DECK / SLAB	REVISON (ADDED RESURFACE POOL DECK) \$19,000 ***INSPECTIONS UNDER THE MASTER PERMIT BL-10-10- 4459*******	final	03/25/2011	03/25/2011	0.00
BL-11-06-6903	06/17/2011	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTER ALTER @ KITCHEN APT # 508 \$3500	final	06/29/2011	04/18/2012	0.00
BL-11-06-7209	06/22/2011	700 BILTMORE WAY	ROOF / LIGHT WEIGHT CONC	RE ROOF \$15,600 FLAT ONLY	final	01/05/2012	02/01/2012	0.00
BL-12-03-9092	03/27/2012	700 BILTMORE	MISCELLANEOUS WORK	REPAIR & PATCH CEILING DRYWALL	final	04/02/2012	04/18/20	0.00

Search Results Page 2 of 3

BL-12-04-9218 04/12/2012 700 MIRRIOR ALTERATION COMMINITERIOR RILING FINAL SPANIS COMMINITERIOR RILING FINAL SPANIS COMMINITERIOR RILING FINAL SPANIS COMMINITERIOR RILING FINAL SPANIS COMMINITION FINAL SPANIS COMMINITION C									
BL-12-08-1351 08/22/2012 700 DOOR/GARAGE BILTMORE DOOR/GAR	BL-12-04-8218	04/12/2012	BILTMORE		RENOVATIONS (KITCHEN), INTERIOR TILING	final	05/01/2012	04/22/2013	0.00
BILTMORE DOOR/SHUTTER/WINDOW ALUMINUM WINDOWS ANODIZED FRAME CLEAR \$5,066	BL-12-06-8988	06/14/2012	BILTMORE	GENERAL REPAIRS	INSPECTOR***SMALL SPALLING REPAIRS ON UNIT 1205 BALCONY AND REPAINT ALL REPAIR	final	07/18/2012	11/07/2013	0.00
BILTHOME CALLY MAY STOCK RENOVATIONS STITCHEN \$4500 COMMERCIAL INTERIOR RENOVATIONS CALLY	BL-12-08-1351	08/22/2012	BILTMORE		ALUMINUM WINDOWS ANODIZED FRAME	final	09/04/2012	09/19/2012	0.00
BILTMORE NLY NTERIOR REMOVATIONS R	BL-12-11-1372	11/26/2012	BILTMORE		RENOVATIONS-	final	01/17/2013	08/19/2013	0.00
BILTMORE WAY WAY MAY	BL-12-12-1138	12/19/2012	BILTMORE		INTERIOR RENOVATIONS (BATHROOM), INTERIOR TILE, PAINT \$12,000 *** REVISED - GWB CEILING & WALLS	final	01/04/2013	07/11/2013	0.00
BILTMORE INTERIOR ONLY CABANA R-4 \$2,250	BL-13-08-1573	08/26/2013	BILTMORE		INTERIOR ALTERATIONS	final	10/11/2013	01/22/2014	0.00
BL-14-01-1746 BLTMORE ONLY CAMINATE FLOORING N. LIVING & DINING &	BL-13-11-1845	11/04/2013	BILTMORE		_	final	11/06/2013	04/22/2014	0.00
BILTMORE WAY BILT	BL-13-11-2717	11/18/2013	BILTMORE		LAMINATE FLOORING IN LIVING & DINING ROOMS, AND	final	11/25/2013	12/02/2013	0.00
BL-14-01-2230 D1/15/2014 700 BILTMORE WAY DEMOLITION DEMOL	BL-14-01-1746	01/06/2014	BILTMORE	GENERAL REPAIRS	INSPECTOR - ROBERTO L. HERNANDEZ P.E ***CONCRETE REPAIRS TO EXTERIOR OF BUILDING \$821,200 ***(AS - BUILT FINAL DWGS	issued	12/11/2014		0.00
BILTMORE WAY	BL-14-01-2230	01/15/2014	BILTMORE		COMM INTER RENOVATIONS	stop work	01/27/2014		0.00
BILTMORE WAY	BL-14-01-2516	01/21/2014	BILTMORE	DEMOLITION	INTERIOR DEMO (ONLY) STE# 815 &	final	02/07/2014	01/30/2015	0.00
BILTMORE WAY	BL-14-03-2695	03/14/2014	BILTMORE		INTERIOR ALTERATIONS (420	final	04/18/2014	12/04/2014	0.00
BL-14-04-2122 04/02/2014 700 MISCELLANEOUS WORK WINTEGRATE PERMIT #07010328-REPAIR DRYWALL, INTERIOR DOOR, INSTALL BASEBOARDS, AND INTERIOR PAINTING \$4000 BL-14-04-2162 04/03/2014 700 DOOR/GARAGE INSTALL SLIDING final 06/18/2014 09/05/2014	BL-14-03-3172	03/24/2014	BILTMORE		COMM INTER RENOVATIONS- KITCHEN, INTER	final	05/15/2014	12/29/2014	0.00
	BL-14-04-2122	04/02/2014	BILTMORE		MIGRATED FROM WINTEGRATE PERMIT #07010328-REPAIR DRYWALL, INTERIOR DOOR, INSTALL BASEBOARDS, AND INTERIOR PAINTING	final	04/03/2014	07/23/2014	0.00
WAY FIXED WINDOW	BL-14-04-2162	04/03/2014	BILTMORE		GLASS DOOR & 1	final	06/18/2014	09/05/2014	0.00

Search Results Page 3 of 3

			and and the second statement of the state of the first of the state of	\$5,200				
BL-14-04-3123	04/21/2014	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTER RENOVATIONS- KITCHEN & BATH \$25,780	final	05/01/2014	11/26/2014	0.00
BL-14-04-3249	04/22/2014		COMMERCIAL FLOORING (INTERIOR ONLY)	INSTALL INTERIOR LAMINATE FLOORING \$4,200	final	04/25/2014	05/07/2014	0.00
BL-14-04-3651	04/28/2014	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMMERCIAL INTERIOR RENOVATONS (DEMO BATHROOM FIXTURES) BLOCK INTERIOR OPENING BETWEEN UNITS \$1,900	final	05/20/2014	07/14/2014	0.00
BL-14-05-3545	05/21/2014	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMMERCIAL INTERIOR RENOVATIONS (KITHCEN) \$8,000	final	06/05/2014	08/19/2014	0.00
BL-14-06-2876	06/12/2014	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTER RENOVATIONS- KITCHEN \$1200	final	06/24/2014	12/01/2014	0.00
BL-14-08-3477	08/22/2014	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COM INTER RENOVATIONS- BATHROOM, NEW FLOORING THROUGHOUT \$12,000	final	09/02/2014	01/21/2015	0.00
BL-14-09-3434	09/29/2014	700 BILTMORE WAY	DEMOLITION INTERIOR ONLY	COMM INTERIOR DEMO ONLY \$12,000	stop work	11/07/2014		0.00
BL-14-09-3437	09/29/2014	700 BILTMORE WAY	INT / EXT ALTERATIONS	COMM INTERIOR DEMO ONLY \$	pending			0.00
BL-15-03-4934	03/23/2015		COMMERCIAL FLOORING (INTERIOR ONLY)	INSTALL INT WOOD FLOORING (NO BATHROOMS) \$3,800	stop work	03/31/2015		0.00
BL-15-04-4875	04/17/2015	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTER RENOVATIONS- BATHROOM SHOWER ENCLOSURE ONLY \$3,250	stop work	04/30/2015		0.00
BL-15-04-5446	04/28/2015		COMMERCIAL FLOORING (INTERIOR ONLY)	INSTALL INT CARPET WITH SOUNDPROOFING \$3,500	stop work	05/05/2015		0.00
BL-15-05-5697	05/26/2015	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMMERCIAL INTERIOR RENOVATIONS (KITCHEN) \$12,000	stop work	06/22/2015		0.00
BL-15-06-4733	06/05/2015	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTERIOR RENOVATIONS- KITCHEN & BATHROOMS \$16,800	final	06/25/2015	08/26/2015	0.00
BL-15-06-6075	06/29/2015	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMMERCIAL INTERIOR ALTERATIONS (CEILING) \$900	final	07/22/2015	08/06/2015	0.00
BL-15-07-4968	07/13/2015	700 BILTMORE WAY	GENERAL REPAIRS	REPAIRS OF (4) COLUMNS \$7,400 WINDOW REPLACEMENT UNDER BL15010490	issued	12/16/2015		0.00
BL-15-08-4541	08/12/2015	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTER RENOVATIONS BATHROOM- EMERGENCY REPAIRS \$1200	final	08/20/2015	11/25/2015	0.00
BL-15-09-3749	09/03/2015	700 BILTMORE WAY	INTERIOR ALTERATION ONLY	COMM INTER RENOVATIONS- KITCHEN & BATHROOMS \$12,000	issued	10/06/2015		0.00

The City's online services are protected with an SSL encryption certificate. For technical assistance, please call 305-569-2448 (8am-5pm, M-F).

Search Results Page 1 of 3



Home

Citizen Services

Business Services

Back to Coral Gables.com

Permits and Inspections: Search Results

Logon

Help

Contact

® New Permit Search

Permit Search Results

Permit#:	App. Date	Street Address	Туре	Description	Status	Issue Date	Final Date	Fees Du
EL-10-06-4884	06/23/2010	700	ELEC COMMERCIAL / RESIDENTIAL WORK	CHANGEOUT TWO ELECTRICAL LIGHT FIXTURES AT POOL LEVEL (COMMON AREAS) \$600	final	06/25/2010	06/30/2010	0.00
EL-10-10-5851	10/29/2010		ELEC COMMERCIAL / RESIDENTIAL WORK	2 LIGHT SOCKETS AND 4 ROUGH IN OUTLETS	final	11/01/2010	06/15/2011	0.00
EL-10-11-3864	11/16/2010		ELEC POOL / SPA / FOUNTAIN	ELECTRIC FOR POOL REPAIRS	final	11/16/2010	02/22/2011	0.00
EL-10-11-3880	11/16/2010		ELEC COMMERCIAL / RESIDENTIAL WORK	WORKWITH TO REPAIR DAMAGE PART IN EXIXTING TRANSFER SWITCH. \$ 2100.	final	11/16/2010	01/04/2011	0.00
EL-11-02-5703	02/22/2011		ELEC COMMERCIAL / RESIDENTIAL WORK	REPLASE 30 RECESS LIGHTS AROUND POOL AREA	final	02/22/2011	02/22/2011	0.00
EL-11-04-6224	04/15/2011		ELEC COMMERCIAL / RESIDENTIAL WORK	ELECTRICAL FOR COOLING TOWER 2 - 15 HORSE POWER MOTOTR AND 1 400 AMP DISCONNECT	final	04/29/2011	06/07/2011	0.00
EL-11-04-6319	04/18/2011		ELEC COMMERCIAL / RESIDENTIAL WORK	KITCHEN 9 OUTLETS.	final	04/19/2011	02/06/2012	0.00
EL-11-06-7075	06/21/2011		ELEC COMMERCIAL / RESIDENTIAL WORK	4 LIGHT SOCKETS 4 ROUGH IN OUTLETS	final	07/22/2011	08/17/2011	0.00
EL-11-06-7217	06/22/2011		ELEC COMMERCIAL / RESIDENTIAL WORK	INSTALL OUTLET FOR STOVE \$900	final	06/22/2011	08/12/2011	0.00
EL-11-11-5106	11/07/2011		ELEC COMMERCIAL / RESIDENTIAL WORK	REPLACE 105 FLOURECENT FIXTURES AT THE BASEMENT PARKING AREA. \$8000	final	11/07/2011	12/15/2011	0.00
EL-12-01-6665	01/13/2012		ELEC COMMERCIAL / RESIDENTIAL WORK	REPLACE 18 LIGHTS IN GARAGE FOYER \$1500	final	01/13/2012	01/20/2012	0.00
EL-12-01-7370	01/25/2012		ELEC COMMERCIAL / RESIDENTIAL WORK	AFTER THE FACT PERMIT FOR INSTALLATIN OF WIRING FOR SWITCH HIGH HATS IN KITCHEN AREA \$700	final	02/07/2012	02/08/2012	0.00

Search Results Page 2 of 3

EL-12-04-8455	04/17/2012	ELEC COMMERCIAL / RESIDENTIAL WORK	ONE OUTLET FOR KITCHEN EXHAUST	final	05/18/2012	06/14/2012	0.00
EL-12-11-1535	11/28/2012	ELEC COMMERCIAL / RESIDENTIAL WORK	4 LIGHT SOCKETS AND 6 ROUGH IN OUTLETS	final	03/01/2013	06/06/2013	0.00
EL-12-12-1397	12/26/2012	ELEC COMMERCIAL / RESIDENTIAL WORK	1 OUTLET,2 SOCKEST,3 SWITCHES,1 BATH FAN	final	02/05/2013	05/07/2013	0.00
EL-13-03-0522	03/08/2013	ELEC COMMERCIAL / RESIDENTIAL WORK	ELECTRICAL TO REPLACE 2 71/1 HP PUIMP MOTORS	final	03/25/2013	04/08/2013	0.00
EL-13-03-1632	03/25/2013	ELEC COMMERCIAL / RESIDENTIAL WORK	SUPPLEMENT EL- 12-12-1397 ADDING 12 SOCKETS	final	03/26/2013	03/26/2013	0.00
EL-13-08-0552	08/09/2013	ELEC COMMERCIAL / RESIDENTIAL WORK		pending			0.00
EL-13-09-0815	09/17/2013	ELEC COMMERCIAL / RESIDENTIAL WORK	10 RECEPTACLES AND 5 LIGHTS \$1,700	final	09/17/2013	09/26/2013	0.00
EL-13-09-1601	09/30/2013	ELEC COMMERCIAL / RESIDENTIAL WORK	4 ROUGH IN OUTLETS AND 3 COMMERCIAL OUTLETS	final	10/15/2013	01/17/2014	0.00
EL-14-01-2365	01/17/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	2 LIGHT SOCKETS; 4 ROUGH IN OUTLETS AND 2 SPECIAL OUTLETS	final	05/15/2014	07/11/2014	0.00
EL-14-01-2617	01/23/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	ELECTRICAL DEMO FOR #815 AND #816	canceled		01/29/2015	0.00
EL-14-03-2846	03/18/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	42 LIGHT, 44 ROUGH IN OUTLETS; 4 SPECIAL COMMERCIAL OUTLETS AND REPLACE PANEL	final	06/09/2014	11/17/2014	0.00
EL-14-04-3568	04/28/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	COMM INTER ALTER-KITCHEN & BATH 7 LIGHT FIXTURES AND 58 ROUGH IN OUTLETS	final	05/23/2014	09/12/2014	0.00
EL-14-04-3671	04/29/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	COMMERCIAL INTERIOR ALTERATIONS \$1,900	final	05/21/2014	05/23/2014	0.00
EL-14-04-3858	04/30/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	5 SOCKETS,3 OUTLETS	final	07/30/2014	12/29/2014	0.00
EL-14-05-3695	05/23/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	COMMERCIAL INTERIOR RENOVATIONS (KITHCEN) 8 ROUGH IN OUTLETS;	final	07/03/2014	07/30/2014	0.00
EL-14-06-3059	06/16/2014	ELEC COMMERCIAL / RESIDENTIAL WORK	COMM INTER RENOVATIONS- KITCHEN ELECRICAL 5 ROUGH IN OUTLETS AND 1 SPECIAL OUTLET	final	06/24/2014	11/21/2014	0.00
EL-14-10-2216	10/06/2014	ELECTRICAL COMMERCIAL /RESIDENTIAL WORK	COMM INTERIOR DEMO ONLY ELECTRICAL	stop work	01/30/2015		0.00
EL-15-05-5704	05/27/2015	ELEC COMMERCIAL / RESIDENTIAL WORK	COMM INTER RENOVATIONS-	final	06/30/2015	07/14/2015	0.00

Search Results Page 3 of 3

		WAY		KITCHEN APT 401 4 ROUGH IN OUTLETS AND 3 SPECIAL OUTLETS			
EL-15-06-4866	06/09/2015		ELECTRICAL COMMERCIAL /RESIDENTIAL WORK	COMM INTERIOR RENOVATIONS- KITCHEN & BATHROOMS	final	07/30/2015 08/20/20	15 0.00
EL-15-08-4074	08/03/2015		ELEC COMMERCIAL / RESIDENTIAL WORK	INSTALLATION OF NEW LAMP SUITE 419	final	08/04/2015 08/05/20	15 0.00
EL-15-09-3791	09/04/2015		ELECTRICAL COMMERCIAL /RESIDENTIAL WORK	COMM INTER RENOVATIONS- KITCHEN & BATHROOMS 4 LIGHT SOCKETS	Issued	11/09/2015	0.00
EL-15-10-5600	10/26/2015		ELEC COMMERCIAL / RESIDENTIAL WORK	TEMP FOR CONTRUCTION TO REPAIR CONCRTE FLOORING AT FPL VAULT ON TOP FLOOR DUE TO CONCRETE FLOOR FAILURE- FPL WILL REMOVE THE TRANSFORMERS; REPAIR FLOOR AND REINTALL NEW TRANSFOREMERS THIS TEMP IS FOR 2400 AMP- \$74000	issued	10/26/2015	0.00
EL-15-11-5391	11/10/2015		ELEC COMMERCIAL / RESIDENTIAL WORK	30 AMP OUTLET FOR CAR CHARGER- COMMON AREA PARKING \$500	final	11/10/2015 11/10/20	15 0.00
EL-15-12-5022	12/07/2015		ELEC COMMERCIAL / RESIDENTIAL WORK	6 NEW OUTLETS \$420	issued	12/08/2015	0.00

The City's online services are protected with an **SSL encryption certificate**. For technical assistance, please call 305-569-2448 (8am-5pm, M-F).

Search Results Page 1 of 3



Home

Citizen Services

Business Services

Back to Coral Gables.com

Permits and Inspections: Search Results

Logon

Help

Contact

Mew Permit Search

Permit Search Results

Permit#:	App. Date	Street Address	Туре	Description	Status	Issue Date	Final Date	Fees Due
PL-08-01-1040	01/24/2008		PLUMB COMMERCIAL / RESIDENTIAL WORK	RE-PIPING FOR WATER HEATER \$2,300 IN BETWEEN 9TH & 10TH FLOOR	stop work	01/25/2008		0.00
PL-09-08-3134	08/31/2009		PLUMB COMMERCIAL / RESIDENTIAL WORK	REPAIR DRAIN PIPE \$4,000	stop work	09/09/2009		0.00
PL-10-04-4324	04/19/2010		PLUMB COMMERCIAL / RESIDENTIAL WORK	REPLACE CORRODED SECTION OF SANITARY SEWER LINE IN CEILING OF BASEMENT \$1,000	final	05/26/2010	06/10/2010	0.00
PL-10-04-4492	04/21/2010		PLUMB COMMERCIAL / RESIDENTIAL WORK	REPIPING FOR BROKEN DRAIN \$1,800	final	05/26/2010	06/11/2010	0.00
PL-10-05-4285	05/17/2010		PLUMB COMMERCIAL / RESIDENTIAL WORK	REPLACE SANITARY SEWER LINES IB BASEMENT \$9,950	final	05/21/2010	05/26/2010	0.00
PL-10-11-2967	11/03/2010		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR REPAIR AND REPLACE TILE IN MASTER BATHROOM AND HALLWAY BATHROOM APT 701	final	11/04/2010	06/15/2011	0.00
PL-11-04-6225	04/15/2011		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING FOR BACKFLOW AND CONDENSATE FOR TOWER	final	04/29/2011	06/10/2011	0.00
PL-11-05-5583	05/05/2011		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING FOR KITCHEN REMODELING	final	05/20/2011	02/06/2012	0.00
PL-11-06-7090	06/21/2011		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER ALTER @ KITCHEN	final	01/03/2012	04/16/2012	0.00
PL-12-04-8315	04/13/2012		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER ALTER #319	final	06/08/2012	06/20/2012	0.00
PL-12-12-0608	12/11/2012		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER RENOVATIONS- KITCHEN	final	06/06/2013	06/25/2013	0.00
PL-12-12-1457	12/28/2012		PLUMB COMMERCIAL / RESIDENTIAL WORK	COMMERCIAL INTERIOR RENOVATIONS (RESET BATHROOM FIXTURES ONLY)	final	02/08/2013	06/12/2013	0.00
PL-13-03-0468	03/07/2013		PLUMB COMMERCIAL / RESIDENTIAL WORK	REPLACEMENT OF DOMESTIC WATER PUMP SYSTEM & 4 INCH RPZ	final	03/25/2013	08/07/2013	0.00

			BACKFLOW \$22,000				
PL-13-05-0951	05/15/2013	PLUMB COMMERCIAL / RESIDENTIAL WORK	REMOVE AND REPLACE FOR A OVEN \$1,349	final	05/21/2013	06/04/2013	0.00
PL-13-07-0829	07/12/2013	PLUMB COMMERCIAL / RESIDENTIAL WORK	REPAIR OF DRAIN LINE IN BASEMENT \$12,000	stop work	07/19/2013		0.00
PL-13-09-0070	09/03/2013	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMMERCIAL INTERIOR ALTERATIONS STE#916	final	10/15/2013	01/14/2014	0.00
PL-13-11-2706	11/18/2013	PLUMB COMMERCIAL / RESIDENTIAL WORK	REPAIR GALVANIZED GAS LINE BETWEEN APT 916 & 917 \$1,200	final	11/19/2013	05/28/2014	0.00
PL-14-01-2491	01/21/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER RENOVATIONS- KITCHEN	final	05/12/2014	07/11/2014	0.00
PL-14-01-2639	01/23/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	***CANCELLED***	canceled		01/29/2015	0.00
PL-14-03-2754	03/17/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER ALTER APT 815	final	06/24/2014	11/26/2014	0.00
PL-14-04-2123	04/02/2014	PLUMB CHANGE OF CONTRACTOR	MIGRATED FROM WINTEGRATE PERMIT #07010328- REPAIR DRYWALL, INTERIOR DOOR, INSTALL BASEBOARDS, AND INTERIOR PAINTING \$4000	final	07/02/2014	07/03/2014	0.00
PL-14-04-3261	04/22/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER ALTER-KITCHEN & BATH UNIT 919	final	05/27/2014	11/13/2014	0.00
PL-14-04-3686	04/29/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	CHANGE OUT GAS VALVES \$200 PERMIT RENEWAL #06040205	final	04/29/2014	05/01/2014	0.00
PL-14-04-3713	04/29/2014	PLUMBING COMMERCIA/RESIDENTIAL WORK	PLUMBING WORK CAP OFF FIXTURES IN BATH UNIT R2	final	05/28/2014	06/20/2014	0.00
PL-14-05-2393	05/06/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	***CANCELLED***	pending			0.00
PL-14-05-3889	05/27/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMMERCIAL INTERIOR RENOVATIONS (KITHCEN) APT 1003	final	06/19/2014	07/30/2014	0.00
PL-14-06-3075	06/16/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER RENOVATIONS- KITCHEN	final	06/27/2014	11/20/2014	0.00
PL-14-08-3907	08/29/2014	PLUMB COMMERCIAL / RESIDENTIAL WORK	COMMERCIAL INTERIOR BATHROOM RENIVATION	final	11/05/2014	01/07/2015	0.00
PL-14-10-2079	10/02/2014	PLUMBING COMMERCIA/RESIDENTIAL WORK	PLUMBING CAP- OFF FOR COMM INTERIOR DEMO @ R-PH	pending			0.00
PL-15-04-4767	04/16/2015	PLUMB COMMERCIAL / RESIDENTIAL WORK	REPLACEMENT OF SHOWER PAN \$850	stop work	05/04/2015		0.60
PL-15-04-4913	04/20/2015	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER	approved			127.99

Search Results Page 3 of 3

		WAY		RENOVATIONS- BATHROOM SHOWER ENCLOSURE				
PL-15-05-5860	05/28/2015		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER RENOVATIONS- KITCHEN UNIT 401	final	08/05/2015	08/06/2015	0.00
PL-15-06-4934	06/09/2015	700 BILTMORE WAY	PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTERIOR RENOVATIONS- KITCHEN & BATHROOMS APT # 309	final	07/16/2015	08/18/2015	0.00
PL-15-06-5645	06/22/2015	700 BILTMORE WAY	PLUMB COMMERCIAL / RESIDENTIAL WORK	CHANGE OUT BATH TUB \$700	final	06/29/2015	07/23/2015	0.00
PL-15-08-4626	08/13/2015		PLUMB COMMERCIAL / RESIDENTIAL WORK	REPLACEMENT OF SHOWER PAN ONLY UNIT 210	final	09/18/2015	11/17/2015	0.00
PL-15-09-4797	09/25/2015		PLUMB COMMERCIAL / RESIDENTIAL WORK	PLUMBING WORK FOR COMM INTER RENOVATIONS- KITCHEN & BATHROOMS UNIT 907	issued	12/09/2015		0.00

The City's online services are protected with an **SSL encryption certificate**. For technical assistance, please call 305-569-2448 (8am-5pm, M-F).

Search Results Page 1 of 2



Home

Citizen Services

Business Services

Back to Coral Gables.com

Permits and Inspections: Search Results

Logon

Help

Contact

® New Permit Search

Permit Search Results

Permit#:	App. Date	Street Address	Type	Description	Status	Issue Date	Final Date	Fees Due
ME-08-07-0891	07/16/2008	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	DUCT WORK REMOVAL \$ 200	final	07/21/2008	06/18/2009	0.00
ME-09-01-2395	01/28/2009	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	REPLACE 5 TON A/C CENTRAL UNIT, DUCTWORK \$8,500 IN COMMON AREA	final	01/28/2009	06/16/2009	0.00
ME-10-05-3538	05/06/2010	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	REPLACE COOLING TOWER \$80,000	final	04/15/2011	06/13/2011	0.00
ME-12-04-7713	04/05/2012	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	MECHANICAL PERMIT - COMM INTER ALTER @ KITCHEN APT # 508 \$3500	final	04/05/2012	04/06/2012	0.00
ME-12-04-8333	04/13/2012	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	COMM INTER ALTER \$2400	final	05/29/2012	06/07/2012	0.00
ME-13-02-0659	02/12/2013	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	INSTALL ONE EXHAUST HOOD	final	02/13/2013	06/21/2013	0.00
ME-13-06-0230	06/05/2013	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	12000 BTU CHILLED WAER FAN COIL CHANGEOUT \$3,000	final	06/06/2013	06/13/2013	0.00
ME-13-08-0540	08/09/2013	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	DF&F CHANGE OUT PRIOR TO APPROVAL OR PERMIT \$500	final	10/25/2013	04/16/2014	0.00
ME-14-01-2608	01/22/2014	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	INSTALL NEW KITCHEN HOOD	stop work	08/21/2014		0.00
ME-14-03-3026	03/20/2014	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	REWORK DUCTWORK SUPPLY AND RETURN,	final	07/10/2014	12/02/2014	0.00

Search Results Page 2 of 2

				AND ADD 2 EXHAUST FANS				
ME-14-06-3492	06/20/2014	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	INSTALL NEW KITCHEN HOOD	final	06/27/2014	11/20/2014	0.00
ME-15-07-4890	07/10/2015	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	CANCELED	canceled		07/13/2015	0.00
ME-15-11-6101	11/20/2015	700 BILTMORE WAY	MECH COMMERCIAL / RESIDENTIAL WORK	TEMPORARY CHILLER \$20,000	issued	11/20/2015		0.00

The City's online services are protected with an **SSL encryption certificate**. For technical assistance, please call 305-569-2448 (8am-5pm, M-F).

Search Results Page 1 of 1



Citizen Services

Business Services

Back to Coral Gables.com

Logon

Help

Final

Contact

New Permit Search

Permit Search Results

Permit#:

App. Date Street Address Type RC-13-11-2507 11/14/2013 700 BILTMORE

Permits and Inspections: Search Results

WAY

BUILDING RE

Description

40 YEAR OR issued

Status

Issue Date 11/15/2013

Fees Due Date

600.00

BUILDING RE-CERTIFICATION

The City's online services are protected with an SSL encryption certificate. For technical assistance, please call 305-569-2448 (8am-5pm, M-F).

CERTIFICATION OLDER

Search Results Page 1 of 1



Home

Citizen Services

Business Services

Back to Coral Gables.com

Permits and Inspections: Search Results

Logon

Help

Contact

® New Permit Search

Permit Search Results

Permit#:	App. Date	Street Address	Туре	Description	Status	Issue Date	Final Date	Fees Du
ZN-09-11-2072	11/16/2009	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	RE-VARNISH LOBBY WOODWORK AT GROUND FLOOR (LOBBY AREA) AND INTERIOR PAINT \$200	final	11/16/2009	05/18/2010	0.00
ZN-10-02-3214	02/11/2010	700 BILTMORE WAY	POOL / SPA ONLY - MARBLELITE / SANDBLAST / TILE	CANCELLED - RESURFACE POOL (DIAMOND BRITE) \$11,000	final	02/11/2010	07/06/2010	0.00
ZN-10-03-3218	03/04/2010	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	INTERIOR TILING IN MAIL ROOM \$1,000	final	03/10/2010	04/28/2010	0.00
ZN-10-09-5375	09/29/2010	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	REPAIR AND REPLACE TILE IN MASTER BATHROOM AND HALLWAY BATHROOM \$10,000	final	10/07/2010	06/16/2011	0.00
ZN-10-11-3632	11/12/2010	700 BILTMORE WAY	KITCHEN CABINETS / COUNTERTOPS	REPLACEMENT OF KITCHEN CABINETS \$5,600	final	12/08/2010	02/06/2012	0.00
ZN-11-02-5754	02/22/2011	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	PRESSURE CLEAN WALK WAYS ON EXTERIOR \$600	final	02/22/2011	03/03/2011	0.00
ZN-11-12-6039	12/14/2011	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	PRESSURE CLEAN AND PAINT EXTERIOR WALLS WHITE \$3000	final	12/15/2011	01/13/2012	0.00
ZN-12-08-0735	08/13/2012	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	INTERIOR PAINTING ONLY PAINT HALLWAYS 11 FLOORS AND DOORS \$22,000	final	08/14/2012	03/13/2013	0.00
ZN-12-09-0417	09/10/2012	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	INSTALL LAMINATE FLOORING WITH SOUNDPROOFING \$5,000	final	09/12/2012	09/18/2012	0.00
ZN-14-12-4491	12/29/2014	700 BILTMORE WAY	DUMPSTER / CONTAINER	DUMPSTER	final	12/29/2014	12/29/2014	0.00
ZN-15-01-0876	01/21/2015	700 BILTMORE WAY	PAINT / RESURFACE FL / CLEAN	DF & F -PAINT EXT OF BUILDING BM 2126-70 (WHITE), BM 2126-60 (LIGHT GRAY), BM 2126- 40 (GRAY) AS PER PLANS \$165,000	issued	06/16/2015		0.00

The City's online services are protected with an **SSL encryption certificate**. For technical assistance, please call 305–569-2448 (8am-5pm, M-F).



City of Coral Gables Fire Department

Fire Prevention Division 2815 Salzedo Street, Coral Gables, FL 33134 Fax (305) 460-5598

The items noted below are in violation of the Florida Fire Prevention Code and/or the Florida Administrative Code, Nothing in this report supersedes any previously written, still existing violations for this occupancy/building. You are directed to comply with corrective measures as indicated.

Occupant Name: 700 Biltmore Way Condominium

- 198 units

Address:

700 Biltmore Way

City:

Coral Gables

Inspection Date:

InspectionType:

Inspected By:

Leonard Veight

305-460-5577

Iveight@coralgables.com

10/7/2015, 10/23/2015, 11/30/2015

EXHIBIT

AA-Tactical, Apartment / Condo

Suite:

Occ. Sq. Ft.:

0

FL NFPA 101 13

Floor 1

Chapter 4 General

4.6.12.4 Excerpt: Any device, equipment, system, condition, arrangement, level of protection...

Any device, equipment, system, condition, arrangement, level of protection, fire-resistive construction, or any other feature requiring periodic testing, inspection, or operation to ensure its maintenance shall be tested, inspected, or operated as specified elsewhere in this Code or as directed by the authority having jurisdiction.

Failure to repair or replace Diesel generator tank due to corrosion.

OK Violation cleared on 11/30/2015

NFPA 14 07

Floor 1

Sprinklers

4.8.2.1 FDC caps are in place.

Fire department connections shall be equipped with caps to protect the system from the entry of debris.

Failure to repair FDC caps on the east side of building and throughout building.

OK Violation cleared on 10/23/2015

Inspector Comments:

Inspector Comments - Reinspection #1: The fuel tank violation is still oustanding. This file wil be forwer to the forward of t

Failure to correct violations within 15 days of re-inspection is subject to penalties up to and including the issuance of Civil Citations in the amount of \$200 per violation / per day.

Failure to provide immediate corrective measures when required, may result in administrative action including but not limited to; mandatory fire watch, building evacuation, or stoppage of all work.

Per City Ordinanace 30-4, a Fire Inspection Fee will be billed for this inspection. All fees are subject to change without prior notice.

Thank you for your assistance, If you have any additional questions or to schedule an inspection, please contact the inspector listed at the top of this report.

Signature on file

Company

Representative: Enrique Donate

10/23/2015

Signature on file

Inspector:

Leonard Veight

10/23/2015

Signature on file

Company

Representative:

Signature On File

10/7/2015

Signature on file

Inspector:

Leonard Veight

10/7/2015

Signature on file

Company

Representative:

Holger Lutz

11/30/2015

Signature on file

Inspector:

Leonard Veight

11/30/2015